EXHIBIT G

REDACTED VERSION OF DOCUMENT SOUGHT TO BE SEALED

UNITED STATES DISTRICT COURT NORTHERN DISTRICT OF CALIFORNIA SAN FRANCISCO DIVISION IN RE SEAGATE TECHNOLOGY LLC Case No. 3:16-CV-00523 LITIGATION DECLARATION OF ANDREW HOSPODOR IN SUPPORT OF PLAINTIFFS' MOTION FOR CLASS **CERTIFICATION** DATE: Feb. 9, 2018 9:30 a.m. TIME: Hon. Joseph C. Spero Courtroom G, 15th Floor DEPT:

Case 3:16-cv-00523-JCS Document 184-12 Filed 07/26/18 Page 2 of 100

TABLE OF CONTENTS

2				Page
3] I.	INTI	RODUCTION	1
4	II.	QUA	ALIFICATIONS	1
5	III.	SUM	IMARY OF OPINIONS	3
6	IV.	SUP	PORT FOR AND BASES OF OPINIONS	5
7		A.	Overview of Storage Technology	5
8		B.	The ST3000DM001 Hard Disk Drive	6
9		C.	Measures of Reliability: Annualized Failure Rate and Mean Time Between Failure	8
10			1. AFR and MTBF Generally	8
11			2. Calculating AFR and MTBF	9
12		D.	Seagate's Drive Development and Manufacturing Process	11
13		E.	The Advertised Performance of the ST3000DM001	13
14		F.	When Seagate First Shipped the ST3000DM001 to Customers, It Knew the Drive's AFR Was Higher than Advertised	18
15		G.	The AFR of the ST3000DM001 Remained Higher than Advertised	24
16 17		Н.	Seagate's Reliability Testing Underestimated the True AFR of the Drive	26
18		I.	The ST3000DM001 was Unstable and was Released Prematurely	35
19			1. The ST3000DM001 Had a Very Low Yield	35
20			2. The Engineering Change Logs Also Evidence that the	
21			Drive Was Unstable and Shipped Prematurely	37
22			a. Electrical ECRs	42
23			b. Mechanical ECRs	44
24			c. A Plethora of Firmware Versions Were Released	47
25			d. The Drive was Subject to Repeated Shipping Holds, and the SBS and Distribution Channels were Dumping Grounds for Bad Drives	50
26				50
27			e. Reliability Problems Escalated Rapidly after Release of the ST3000DM001	52
28				

DECL. OF ANDREW HOSPODOR ISO CLASS CERT. - i CONTAINS MATERIAL DESIGNATED AS HIGHLY CONFIDENTIAL Case No.: 3:16-CV-00523 010581-11 997236 V1

Case 3:16-cv-00523-JCS Document 184-12 Filed 07/26/18 Page 4 of 100

		f. Internal Seagate Documents Explicitly Acknowledge that the ST3000DM001 was Unstable, Unreliable, and Defective	56
	J.	Given Its Knowledge that the Drive Was Unstable and Unreliable, Seagate Gradually Changed the Specifications	60
		1. Maximum Case Temperature	61
		2. Maximum Operating Wet Bulb Temperature	62
		3. Unpackaged Storage Specification	62
		4. Workload Rating	63
	K.	Seagate Knew that the Drive Was Not Suitable for RAID	64
V.	SUPP	PLEMENTATION OF OPINIONS	65
APPE	NDIX 1	1	67
APPE	NDIX 2	2	70

DECL. OF ANDREW HOSPODOR ISO CLASS CERT. - ii CONTAINS MATERIAL DESIGNATED AS HIGHLY CONFIDENTIAL Case No.: 3:16-CV-00523 010581-11 997236 V1

I. INTRODUCTION

1. I have been retained as an independent expert by counsel for the Plaintiffs in this action against Seagate Technology LLC ("Seagate" or "Defendant") regarding Seagate's bare drive model number ST3000DM001, which is marketed as a three terabyte ("3TB") hard disk drive, as

well as internal drive retail kits and external drives that use the ST3000DM001.

2. I have been asked by Plaintiffs' counsel to determine whether the ST3000DM001 had a higher than advertised Annualized Failure Rate and whether it was suitable for RAID. I have also been asked to opine, based upon my knowledge of hard drive industry's best practices, on the ST3000DM001's level of reliability, as well as the design and manufacturing processes employed by Seagate for the ST3000DM001, including reliability testing and quality control. I concluded that the ST3000DM001 had a higher than advertised Annualized Failure Rate, was unsuitable for RAID, and was unreliable by industry standards. Plaintiffs' counsel then asked me to determine whether Seagate knew, or should have known, of these issues and I concluded that Seagate was indeed aware of them.

3. In preparing this report and setting forth my opinions and conclusions, I have employed methods and analyses of a type reasonably relied upon by experts in my field in forming opinions or inferences on the subject. To make these determinations, I have relied on my experience and expertise as a Ph.D. computer engineer-scientist, my visual inspection of a ST3000DM001 drive, and my review of certain documents and discovery produced in this case. Materials that I have relied on in forming my opinions are listed in **Appendix 1**, and my curriculum vitae is attached as **Appendix 2**.

II. QUALIFICATIONS

4. I received a Bachelor of Science degree in Computer Engineering from Lehigh University in 1981, a Master of Science degree in Computer Science from Santa Clara University in 1986, and a Ph.D. in Computer Engineering from Santa Clara University in 1994. My Ph.D. emphasis was in storage architecture and systems. My dissertation was entitled: "A Study of Prefetch in Caching SCSI Disk Drive Buffers."

1
2
3
4
5
6
7
8
9
10
11
12
13
14
15
16
17
18
19
20
21
22
23
24
25
26
27

- 5. I have over 25 years of experience in the data storage industry. The following is an overview of my relevant responsibilities during this time period:
 - Firmware Engineering for disk drive and tape drive controllers, including implementation of command processing, error correction, and buffer management;
 - Simulation and implementation of disk buffers and caches at Quantum;
 - Architecting network storage devices that included disk and tape drives;
 - Simulation and implementation of disk interfaces, including SCSI-2 and SCSI; and
 - Interaction with Quality Assurance and Test Engineering groups responsible for performance and reliability of disk and tape drives.
- 6. At Quantum Corporation, I led a team in Systems Engineering that responsible for Operating Systems, Simulation and Performance. Later, I was the key engineering contact responsible for integration of the Digital Linear Tape (DLT) tape drive and library products following the acquisition of Digital Equipment Corporation's storage business by Quantum.
- 7. At Western Digital Corporation, I was the Vice President of Systems Architecture responsible for development of novel new storage architectures.
- 8. I have taught graduate and undergraduate courses at Santa Clara University. After receiving my Master's degree in 1986, I joined the Institute for Information Storage Technology as an Adjunct Lecturer, then later as a Research Fellow. I have taught courses in Computer Architecture, Storage Architecture, Hard Disk and Floppy Disk Controller Design, and Grid Computing. I was previously the Executive Director of the Storage Systems Research Center at University of California, Santa Cruz, until May 31, 2017.
- 9. I am a named inventor on twelve United States Patents related to data storage. I have also authored numerous publications in reference journals, and industry periodicals, and am often cited by my peers in textbooks and journal publications.
- 10. A list of my patents and additional publications I have authored are included in my curriculum vitae attached as Appendix 2 to this report.

- 11. I have previously testified as an expert witness in a variety of cases. A list of cases, in which I have testified, either at trial or by deposition can be found in my curriculum vitae attached as Appendix 2 to this report.
- 12. I have presented to the American National Standards Institute (ANSI) committee on the Small Computer Systems Interface (SCSI), the National Association of Broadcasters (NAB), the SCSI Forum, the Institute of Electrical and Electronic Engineers (IEEE) Systems Design and Network Conference, and many other storage-related conferences.
- 13. A more complete recitation of my qualifications can be found in my curriculum vitae attached as **Appendix 2** to this report.
- 14. I am employed by Berg Software Design. Berg Software Design bills plaintiffs for my time at the rate of \$550 per hour for my expert witness work, plus reimbursement for reasonable travel and other out-of-pocket expenses incurred during my work on this matter. These are standard and customary rates for work of this nature. Berg Software Design and I are each compensated regardless of the facts I know or discover and/or the conclusions or opinions I reach. I have no personal or financial stake or interest in the outcome of this matter.
- 15. My work as an expert in this litigation is subject to an agreed protective order to which I am a signatory. This report refers to and may contain excerpts from documents that are covered by this protective order. As such, it is designated as "HIGHLY CONFIDENTIAL ATTORNEY'S EYES ONLY."

III. SUMMARY OF OPINIONS

16. In this case, I expect to testify about background issues necessary to understand the technology at issue, including an explanation of how hard disk drives ("HDD") work. Such testimony may include the historical evolution of HDD technology and the state of the industry from 2010 until the present day. I also expect to testify as to industry practices for the design and manufacturing process of hard drives, the design and manufacturing process employed by Seagate for the ST3000DM001, the accuracy of Seagate's representations regarding the ST3000DM001, and the ST3000DM001's stability, reliability, annualized failure rate, and suitability for RAID. My

opinions are based on my analyses and review of the documents and materials listed in **Appendix 1**, my visual inspection of a ST3000DM001 drive, and my education and experience. My opinions apply to the ST3000DM001 and the derivative products that incorporate the ST3000DM001, including: Desktop HDD Internal Kit, Desktop External Drive, Barracuda, BackUp Plus Mac, BackUp Plus Desk, FreeAgent GoFlex Desk, GoFlex Desk for Mac, FreeAgent GoFlex Home, Expansion Desk, Expansion Desk Plus, Business 1 BAY NAS, Business 2 BAY NAS, and Business 4 BAY NAS.¹ ¹ I understand that plaintiffs are proposing a nationwide class of the following consumers: All individuals in the United States who purchased new, not for resale,

on or before February 1, 2016, at least one Seagate model ST3000DM001 hard drive or at least one drive with any of the following model numbers on the box it was sold in or on the hard drive's casing or chassis: STAC3000100, STAC3000102, STAC3000202, STAC3000402, STAC3000403, STAC3000404, STAC3000602, STAM3000100, STAM3000400, STAY3000100, STAY3000102, STBC3000101, STBC3000102, STBD3000100, STBM3000100, STBN6000100, STBP12000100, STBV3000100, STBV3000200, STCA3000101, STCA3000600, STCA3000601, STCA3000602, STCB3000100, STCB3000101, STCB3000201, STCB3000400, STCB3000401, STCB3000900, STCB3000901, STCP3000100, STCP3000400, STDT3000100, STDT3000400, STDT3000402, STDT3000600, STDU3000101, STDU3000400, STEB3000100, STEB3000200, STEB3000400, STEG3000100, STEG3000400, STFM3000100, or STFM3000400.

I understand that in the alternative, plaintiffs are proposing the following more narrow class:

All individuals in the jurisdictions of California, Florida, Massachusetts, New York, South Carolina, South Dakota, Tennessee, and Texas, who purchased, not for resale, on or before February 1, 2016, at least one Seagate model ST3000DM001 hard drive or at least one drive with any of the following model numbers on the box it was sold in or on the hard drive's casing or chassis:

STAC3000100, STAC3000102, STAC3000202, STAC3000402, STAC3000403, STAC3000404, STAC3000602, STAM3000100, STAM3000400, STAY3000100, STAY3000102, STBC3000101, STBC3000102, STBD3000100, STBM3000100, STBN6000100, STBP12000100, STBV3000100, STBV3000200, STCA3000101, STCA3000600, STCA3000601, STCA3000602, STCB3000100, STCB3000101, STCB3000201, STCB3000400, STCB3000401, STCB3000900, STCB3000901, STCP3000100, STCP3000400, STDT3000100, STDT3000400, STDT3000402, STDT3000600, STDU3000101, STDU3000400, STEB3000100, STEB3000200,

DECL. OF ANDREW HOSPODOR ISO CLASS CERT. - 4 CONTAINS MATERIAL DESIGNATED AS HIGHLY CONFIDENTIAL Case No.: 3:16-CV-00523 010581-11 997236 V1

1

2

3

4

5

6

7

8

9

10

11

12

13

14

15

16

17

18

19

20

21

22

23

24

25

26

27

1	
2	
3	
4	
5	
6	
7	
8	
9	
10	
11	
12	
13	
14	
15	
16	
17	
18	
19	
20	
21	
22	
23	
24	

26

27

28

- 17. As set forth herein, it is my opinion that the ST3000DM001 had a higher than advertised Annualized Failure Rate, was unsuitable for RAID, and was unreliable by industry standards. I also conclude that Seagate knew of these issues. In particular, it is my professional opinion that:
 - i. The reliability testing and quality control process employed by Seagate for the ST3000DM001 were flawed.
 - ii. Seagate advertised and continued to advertise the ST3000DM001 as reliable and having a specific Annualized Failure Rate ("AFR") even though its own test data did not support this position.
 - iii. The ST3000DM001 was released for production before the design and manufacturing processes were stable and reliable which resulted in an abnormal failure rate.
 - iv. Seagate knew that the ST3000DM001 was unstable, unreliable, and had a higher AFR than advertised.
 - v. Seagate advertised and continued to advertise the ST3000DM001 as being suitable for RAID despite the fact that it knew the drive was inherently unreliable and not suitable for RAID.

IV. SUPPORT FOR AND BASES OF OPINIONS

A. Overview of Storage Technology

- 18. Hard disk drives are electromechanical storage devices that have been used in personal computers since the mid-1980s. Hard drives have only a few basic parts, consisting of, among other things, one or more platters, read-write heads, read-write arms, a central spindle, a spindle motor, and a controller board.
- 19. A platter is a circular disk on which data is stored magnetically in binary form (a code comprised of a series of zeros and ones corresponding to flux transitions on the disk). Hard drives often have more than one platter, which are stacked on top of each other a few millimeters apart. The ST3000DM001 has three platters with a capacity of 1TB each (one terabyte equals 1000 gigabytes or one million megabytes).

STEB3000400, STEG3000100, STEG3000400, STFM3000100, or STFM3000400.

- 1 2

- 20. The central spindle is the shaft that holds the platters in place and allows them to rotate at high speeds. The central spindle is powered by a spindle motor.
- 21. The read-write arm, which has a tiny read-write head on the end, stretches out over the platter and moves over it, reading and writing data to the platter while the platter is spinning. Since both sides of a platter are usually used for data storage, there are typically two read-write heads for each platter. The ST3000DM001 was first produced using six heads, with data on each of the three platters accessed by a pair of heads located above and below each platter.
- 22. The controller board controls components that allow the hard drive to function. Put simply, the controller board controls the flow of data to and from the platters in the hard drive.

B. The ST3000DM001 Hard Disk Drive²

23. The drives at issue in this litigation contain the ST3000DM001 hard disk drive. The ST3000DM001 had an advertised capacity of 3 Terabytes ("3TB") and had been in production since 2011. The ST3000DM001 consisted of the following products:

Marketing Product Name	Bare Drive Model Number ³
Desktop HDD Internal Kit	ST3000DM001
Desktop External Drive	ST3000DM001
Barracuda	ST3000DM001
BackUp Plus Mac	ST3000DM001
BackUp Plus Desk	ST3000DM001
FreeAgent GoFlex Desk	ST3000DM001
GoFlex Desk for Mac	ST3000DM001
FreeAgent GoFlex Home	ST3000DM001
Expansion Desk	ST3000DM001
Expansion Desk Plus	ST3000DM001
Business 1 BAY NAS	ST3000DM001
Business 2 BAY NAS	ST3000DM001

³ The Desktop HDD Internal Kit and the Barracuda were internal drives. The Desktop External Drive, BackUp Plus Mac, BackUp Plus Desk, FreeAgent GoFlex Desk, GoFlex Desk for Mac, FreeAgent GoFlex Home, Expansion Desk, and Expansion Desk Plus were external drives. Although the external drives had different model numbers on their boxes and outer casings, the drives inside of the casings were model number ST3000DM001. Likewise, the Desktop HDD Internal Kit had a different model number on its box, but it was a ST3000DM001 drive. The Business 1, 2, and 4 Bay NAS were network attached storage devices that came with ST3000DM001 drives.

See Seagate Technology, LLC's Second Amended Response to Interrogatory No. 9, at p.3.

- 24. These products were all based on and included the same, highly leveraged, internal design. This design was referred to within Seagate as the "Grenada" family of disk drives.
- 25. Because demand for the product was high, Seagate planned to release the Grenada in phases and highly leverage its use. Internally, the phased Grenada iterations were referred to as the Grenada Classic, Grenada BP,⁴ Grenada BP PL,⁵ and Grenada BP 2,⁶ and they were all model number ST3000DM001. In this report, "Drive" will refer to a disk drive in the Grenada family having model number ST3000DM001, including external drives and internal retail kits that have a different model number on their boxes and/or outer casings but have a ST3000DM001 inside.
 - 26. Seagate used the following internal product code names for the Grenada drives:

Product Code Name	Marketing Product
Troduct Code Ivanic	Name
Retail Kit	Desktop HDD Internal Kit
Raptor	Desktop External Drive
Grenada	Barracuda
Grenada BP	Barracuda
Grenada BP PL	Barracuda
Grenada BP 2	Barracuda
Stratus	BackUp Plus Mac
Stratus	BackUp Plus Desk
Udon	BackUp Plus Mac
Udon	BackUp Plus Desk
Rockit Desk	FreeAgent GoFlex Desk
Rockit Desk	GoFlex Desk for Mac
Explorer	FreeAgent GoFlex Home
Falcon Desk	Expansion Desk
Sake	Expansion Desk Plus
Sentinel	Business 1 BAY NAS

⁴ Oft times referred to in Seagate documentation as "GrenadaBP" or by its full name "Grenada BlockPoint."

DECL. OF ANDREW HOSPODOR ISO CLASS CERT. - 7 CONTAINS MATERIAL DESIGNATED AS HIGHLY CONFIDENTIAL Case No.: 3:16-CV-00523 010581-11 997236 V1

3

45

6

7

9

11

12

13

1415

16

17

18

19

20

2122

23

24

25

2627

⁵ Oft times referred to in Seagate documentation as "GrenadaBPPL," "GrenadaBP+," or by its full name "Grenada BlockPoint Plus."

⁶ Oft times referred to in Seagate documentation as "GrenadaBP2" or by its full name "Grenada BlockPoint 2."

4

9 10

8

11 12

13 14

15

16 17

18

20

19

21 22

23 24

25

26

27

28 DECL. OF ANDREW HOSPODOR ISO CLASS CERT. - 8

C. Measures of Reliability: Annualized Failure Rate and Mean Time Between Failure

1. AFR and MTBF Generally

- 27. Annualized Failure Rate, or AFR, is a measure of reliability for a device or component, and it is widely used in the hard drive industry. AFR is the projected percentage of drives of a particular model that will fail in a given year. Changes in AFR can expose problems with a drive's manufacture or design but do not include failures due to misuse by the end-user. Furthermore, AFR projections are based upon an assumption that failures are independent. This assumption is not valid when drives have related failures resulting from contamination, the introduction of a faulty part, or other design or manufacturing process issues. As discussed in more detail below, common failure modes of the ST3000DM001 were contamination and head-related failures.
- 28. Mean time between failure, or MTBF, is another measure of hard drive reliability used across the hard drive industry. It refers to the average number of hours that are projected to elapse between one failure and the next in a population of hard drives.
- 29. There is an inverse relationship between AFR and MTBF; the higher the AFR, the lower the MTBF. Likewise, the lower the AFR, the higher the MTBF. AFR can be calculated from MTBF, and vice-versa.
- AFR is widely advertised by hard drive manufacturers in consumer-facing materials 30. such as product manuals and specification sheets. As discussed in more detail below, Seagate advertised the ST3000DM001 as having an AFR of <1%.
- MTBF was widely quoted in consumer-facing materials, but in recent years the trend 31. in the industry has been to quote AFR rather than MTBF. This is because MTBF can be confusing to consumers; MTBF ratings often reach hundreds of thousands of hours or even a million hours or more, and this has led some consumers to believe that their hard drives can function for 25, 50, or even 100 years. This is not the case, however, because like AFR, MTBF is a population statistic and it doesn't reflect the number of hours that an individual unit will last. Largely due to this potential for

CONTAINS MATERIAL DESIGNATED AS HIGHLY CONFIDENTIAL Case No.: 3:16-CV-00523 010581-11 997236 V1

confusion, the industry has shifted towards stating the AFR in consumer materials because it is easier to understand.

- 32. Around the time that the ST3000DM001 was introduced, Seagate moved away from quoting MTBF to instead quoting just AFR. The rationale for this was substantially the same as the above.⁷ Internally, Seagate continued to use both MTBF and AFR in assessing a hard disk drive's reliability.
- 33. As would be expected of any reliability metric, AFR is not accurate indefinitely. Rather, AFR is a failure rate that applies over a specific interval: the expected service lifetime of the product. The expected service lifetime for most hard drives is five years, so the advertised AFR of a hard drive, if properly calculated, represents the annual failure rate during the first five years the drive is used to store user data. The ST3000DM001 was designed with an expected service life of five years, but internal Seagate testing revealed that the AFR was projected to be significantly greater than 1% for even the first year of use.

2. Calculating AFR and MTBF

34. The data used to calculate AFR and MTBF is usually obtained by conducting accelerated life testing. Accelerated life testing consists of running a large population of drives 24 hours per day and 7 days per week for at least 30 days in special test chambers which subject the drives to extreme conditions, such as temperature and voltage levels above and below the values

⁷ Seagate, Hard disk drive reliability and MTBF / AFR http://knowledge.seagate.com/articles/en_US/FAQ/174791en?language=en_US&key=ka03000000tmWGAAY&kb=n&wwwlocale=en-us (last accessed October 10, 2017).

⁸ See FED_SEAG0056259, at 56262. This page contains a chart listing a 5-year service life goal for various Seagate products, including desktop drives such as the ST3000DM001 (labeled in the chart as "DT Disty HDD"), and external drives (labeled as "SBS Backup HDD"). Seagate intentionally failed to inform consumers in many published materials that the ST3000DM001 had a five-year service life. See FED_SEAG0055831, at 55833 ("Five year service life will not be part of customer specs/contracts.").

⁹ In fact, until 2014, Seagate only calculated the AFR for the first year of Drive use. This is because Seagate presumed that the Drive's failure rate would decline after the first year. As will be explained in greater detail in Section H, the Drive's failure rate actually increased with time, thus Seagate underestimated the true AFR by only calculating the first-year AFR. None of the Seagate consumer-facing materials I have reviewed informed consumers that the AFR Seagate was advertising was only for the first year.

listed in the disk drive's specification. Running the drives under these extreme conditions "accelerates" the testing to allow the prediction of failures over the expected lifetime of a disk drive.

- 35. The data obtained from accelerated life testing that is used to calculate AFR and MTBF includes, among other things, the number of drive failures that occurred during testing, the amount of time it took the drives to fail, the temperature of the test chambers, the voltages provided to the drives, and the number of power-on hours the drives were designed for.
- 36. Power-on hours, abbreviated "POH," are the number of hours a year that the drive is powered on. Seagate assumes a POH value of 2400 when *calculating* the AFR and MTBF for desktop drives, such as the ST3000DM001. This is equivalent to approximately 6.5 hours a day, 7 days a week, or approximately 9 hours a day, 5 days a week, for an entire year.
- 37. As discussed more fully in Section J, below, notwithstanding that Seagate assumed an average POH value of 2400 for desktop drives, including the ST3000DM001, when it calculated the AFR, several iterations of the Product Manual for the ST3000DM001 represented to consumers that its AFR is based upon an 8760 POH workload, which is equivalent to 24 hours a day, 7 days a week. If a drive is designed for 2400 POHs and its AFR is calculated using that POH figure, the stated AFR will not accurately reflect the actual failure rate of the drive if it is used at 8760 POHs.
- 38. In addition to the foregoing, a mathematical function known as a Weibull distribution is employed when calculating AFR. Data obtained during testing is used to calculate the beta parameter of the Weibull distribution, and the beta is then used in projecting AFR. As discussed in more detail in Section H, the Weibull beta calculated by Seagate did not match the true failure characteristics of the ST3000DM001, which demonstrates that Seagate's testing was flawed and underestimated the true AFR of the Drive.

Case No.: 3:16-CV-00523 010581-11 997236 V1

¹⁰ The Product Manual for the ST3000DM001 was updated approximately a dozen times, including in October 2012, March 2014, May 2014, August 2014, and January 2015. In the October 2012 Product Manual, the workload was quoted as 8760 POHs, and it remained so until it was changed to 2400 POHs in January 2015. *See* October 2012 Product Manual, FED_SEAG0030657, at 30668; March 2014 Product Manual, FED_SEAG0004163, at 4171; May 2014 Product Manual,

FED_SEAG0003839, at 3847; August 2014 Product Manual, FED_SEAG0004103, at 4171, May 2014 Product Manual, FED_SEAG00030777, at 30786; January 2015 Product Manual, FED_SEAG0004438, at 4447.

D. Seagate's Drive Development and Manufacturing Process

39. Seagate follows a "Product Life Cycle Process" when it designs, develops, and releases drives. This process consists of product planning, research and technology development, and drive development stages. In the drive development stage, there are 11 phases, ranging from "Advanced Product Development" to "EOL," which stands for "end of life" (drive discontinuation). At the end of each phase is a checkpoint, many of which are referred to as "exits," which contain certain criteria and milestones that must be met before the drive can proceed to the next phase.

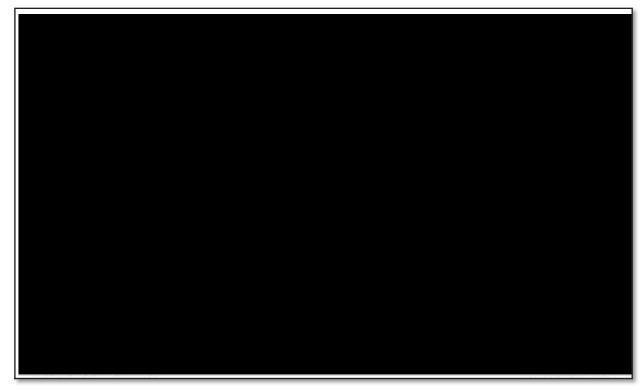


Figure 1: Seagate's Product Life Cycle Process

40.

¹¹ See FED_SEAG0027285, at 27287.

¹² *Id*.

¹³ See id.; Almgren Dep., at 98:8-13, 100:14-101:9.

¹⁴ Almgren Dep., at 111:5-112:11.

41.

The term "OEM" refers to drives that are sold to Original Equipment, anufacturers, which are companies like Apple and Hewlett-Packard that put the drives into the computers they sell to consumers. The term "disty" refers to the "distribution channel," which includes bare drives that Seagate sells to resellers like NewEgg and Amazon, who in turn sell them to consumers. A bare drive is simply a hard drive that is sold without any branded packaging or accessories such as cables or mounting brackets.

42.

.15 The term "SBS" stands for "Seagate Branded Solutions," and it consisted of Drives sold in Seagate-branded packaging with accessories such as cables, and it included Internal Drive Kits and external Drives. 16 SBS Drives were sold by Seagate to retailers such as Best Buy and Costco, who resold them to consumers.

43. The Grenada family of drives consisted primarily of the Grenada, sometimes referred to as the "Grenada Classic," the Grenada BP, and the Grenada BP2. The Grenada Classic went through the entire Product Life Cycle Process, but the Grenada BP and the Grenada BP2, which were released after the Grenada Classic, did not because they were not "brand-new designs" but were rather updates of the Grenada Classic. ¹⁷ Consequently, the development time for these version of the

 $^{^{15}\} See$ Almgren Dep. 119:3-122:14.

¹⁶ See Almgren Dep. 117:9-118:1. See also FED_SEAG0028126, at row 842 (listing the 3TB Desktop HDD Internal Kit as an SBS drive), row 2654 (listing the Backup Plus Mac as a SBS drive), row 3295 (listing the BackUp Plus Desk as a SBS drive), row 5465 (listing the Expansion Desk as a SBS drive), row 635 (listing the Expansion Desk Plus as a SBS drive), row 3676 (listing the GoFlex Desk as a SBS drive).

¹⁷ See Dewey Dep. at 207:7-208:8. Patrick Dewey, a corporate designee for Seagate, testified that, with regard to the Grenada BP2,

Grenada was shorter.¹⁸ As discussed above, because they were all based on the same design and part of the same drive family, Seagate used the same model number, ST3000DM001, for each iteration of the Drive.

E. The Advertised Performance of the ST3000DM001

- 44. Seagate first released the ST3000DM001 on or around April 28, 2011. The Drives released at this time were the SBS drives external drives and the internal drive kit. Seagate released the "bare drive" ST3000DM001 on or around October 18, 2011.
- 45. From the time the ST3000DM001 was first released in 2011, Seagate advertised its AFR as <1%, 0.34%, or both. Seagate also marketed the Drive as "best-fit" and "perfect" for desktop RAID.¹⁹
- 46. I reviewed numerous documents that were produced by Seagate during discovery containing statements about the Drive's AFR and RAID capabilities. I also reviewed multiple archived versions of Seagate's website dating back to November 2011 by using the "Wayback Machine." The Wayback Machine is a webpage archival service run by the Internet Archive, a non-profit organization based in San Francisco. The Wayback Machine has been saving and archiving webpages across the Internet since 1996, and to date it has archived over 306 billion webpages.²⁰
- 47. The Wayback Machine automatically visits a webpage periodically (every few weeks or months) and captures a new version of the page. Each time a new version of the webpage is captured, it is archived and becomes accessible to anyone who searches for the webpage on the Wayback Machine website, https://archive.org/web/. Therefore, entering "Seagate.com" into the Wayback Machine website allows the user to view the Seagate website as it appeared on any of the numerous dates on which it was archived.

¹⁸ *See* Almgren Dep, at 38:3-12.

¹⁹ FED SEAG0015567, at 15568.

²⁰ See Wayback Machine, https://archive.org/web/ (last accessed October 31, 2017) (stating "Explore more than 306 billion web pages saved over time.").

48. Around the time that Seagate first released the ST3000DM001 in April 2011, it released a Product Manual for the Drive. The Product Manual contained information and specifications for the Drive, such as its capacity, maximum operating temperature, and AFR, as well as instructions on how to install the drive. It was available as a PDF document that could be downloaded from Seagate's website.

49. The Product Manual stated that the ST3000DM001 had an AFR of 0.34%, as shown below.²¹

on-recoverable read errors	1 per 10 ¹⁴ bits read	1 per 10 ¹⁴ bits read		
nnulized Failure Rate (AFR)	234%	0.34%		
farranty	web page: support seasate com From this page, click on the "Ve	specific drive, use a web browser to access the following (customer/marranty_validation.is); ifly Your Warranty 'link. You will be asked to provide the er (or part number) and country of purchase. The system from for your drive.		
oad/Unload cycles (25°C, 50% rel. humidity)	300,000	300,000		
upports Hotplug operation per the Serial ATA exision 2.5 specification	Yes Yes			
malting.	S ASSLEM	spacity may vary depending on operating environment and		
uring periods of drive idle, some offine activit operational levels.	rmay occur according to the S.M.A.	R.T. specification, which may increase acoustic and power		

Figure 2: Excerpt from April 2011 Product Manual (highlight added for ease of reading).

50. Seagate also advertised the AFR of the ST3000DM001 directly on its website. By November 2011, at the latest, Seagate's website listed the AFR as <1%, as shown in the figure below.

Case No.: 3:16-CV-00523 010581-11 997236 V1

²¹ See April 2011 Product Manual FED_SEAG0019045, at FED_SEAG0019056.

2

3

4

5

6

7

8

9

10

11

12

13

14

15

16

17

18

19

20

21

22

23

24

25

26

27

Figure 3: Relevant portion of archived page from Seagate's website as it appeared on November 29, 2011 (highlight added).²²

- 51. By November 2011 at the latest, Seagate released a Data Sheet for the ST3000DM001, which was available as a PDF document that could be downloaded from Seagate's website.²³ Like the Product Manual, the Data Sheet contained specifications for the Drive, including AFR, but also contained marketing statements about the Drive's "Key Advantages" and "Best-Fit Applications."
- 52. The Data Sheet advertised the AFR of the ST3000DM001 as <1%, and it asserted that "Desktop RAID" was one of the "Best-Fit Applications" for the Drive.²⁴ Other consumer-facing

²² Seagate, *Barracuda Desktop Hard Drives*, https://web.archive.org/web/20111129033926/http://www.seagate.com:80/www/en-us/products/desktops/barracuda_hard_drives#TabContentSpecifications (click on "Specifications" tab) (archived November 29, 2011).

²³ Seagate, *Barracuda Desktop Hard Drives*, https://web.archive.org/web/20111129033926/http://www.seagate.com:80/www/en-us/products/desktops/barracuda_hard_drives (archived Nov. 29, 2011) (containing a link to the Data Sheet).

²⁴ FED_SEAG0015567, at 15568.

materials subsequently published by Seagate advertised the Drive as "perfect" for "desktop RAID arrays." ²⁵

53. By April 2012, Seagate changed the Drive's AFR listed on Seagate's website from <1% to "0.34%, <1%," as shown below. The Data Sheet remained unchanged.

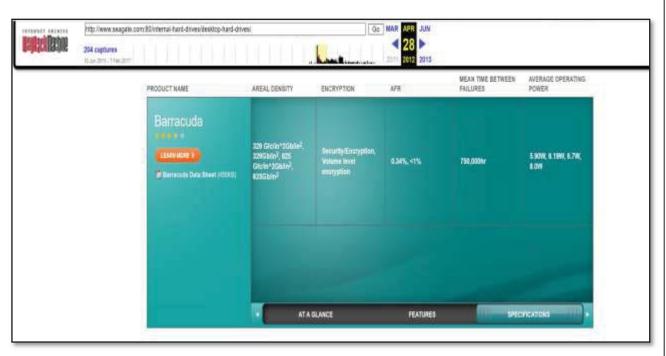


Figure 4: Relevant portion of an archived page from Seagate's website as it appeared on April 28, 2012.²⁶

54. Seagate continued to advertise the AFR of the ST3000DM001 on its website as "0.34%, <1%" until at least January 2013.²⁷ The AFR specification was thereafter removed from the

²⁵ For instance, multiple iterations of the Desktop HDD Kit Data Sheet stated that the Drive is "perfect for" RAID. See FED_SEAG0000476 (copyrighted 2015); FED_SEAG0020175 (copyrighted 2014); FED_SEAG0002109 (copyrighted 2013). Moreover, Seagate supplied product descriptions to retailers such as Amazon, Newegg, and Walmart, and the retailers published the descriptions on webpages where they sold the ST3000DM001. These descriptions stated that the ST3000DM001 was "perfect when you need to . . . implement a desktop RAID." FED_SEAG55589, at 55592.

²⁶ See Seagate, Desktop Hard Drives, https://web.archive.org/web/20120428124406/http://www.seagate.com:80/internal-hard-drives/desktop-hard-drives/ (click on "specifications" tab) (archived April 28, 2012).

²⁷ See Seagate, Desktop Hard Drives, https://web.archive.org/web/20130117005718/http://www.seagate.com/internal-hard-drives/desktop-hard-drives/ (click on "Specifications" tab) (archived Jan. 17, 2013). In or around February 2013, Seagate changed the marketing name of the ST3000DM001 (the name that appears on the box, on the Drive itself, and on consumer-facing DECL. OF ANDREW HOSPODOR ISO CLASS CERT. - 16 CONTAINS MATERIAL DESIGNATED AS HIGHLY CONFIDENTIAL Case No.: 3:16-CV-00523 010581-11 997236 V1

website for a brief period, only to return in September 2013 as "0.34%." The AFR specification remained on the website until at least January 2014.²⁹

- 55. Since that time, the Data Sheet advertising the AFR as <1% was, and still is, hosted on the Seagate website. Indeed, as of November 2, 2017, performing a Google search for the phrase "ST3000DM001 Data Sheet" returns said Data Sheet as the first result.
- 56. Moreover, the AFR specification for the ST3000DM001 remained in various other consumer-facing materials. Namely, an AFR of <1% was also quoted in the Drive's Product Manual from the January 2015 revision until at least the September 2016 revision. This same AFR figure was also quoted in various product catalogues published by Seagate. ³¹
- 57. In addition to statements about the specific AFR and RAID capabilities, the Data Sheets and Seagate's website Seagate advertised the ST3000DM001 as a reliable product.³²
- 58. Although Seagate continued to advertise that the Drive was reliable and had an AFR of <1%, it was aware that there were serious problems with the Drive which affected its reliability and that its own internal testing revealed that the Drive's AFR was higher than advertised.

materials) from Barracuda to Desktop HDD. Despite the marketing name change, the Drive was still a ST3000DM001 and was listed as such in consumer-facing materials and on the label affixed to the Drive.

²⁸ See Seagate, Desktop Hard Drives, https://web.archive.org/web/20130911084603/http://www.seagate.com:80/internal-hard-drives/desktop-hard-drives/ (click on "Specifications" tab) (archived September 11, 2013).

²⁹ See Seagate, Desktop Hard Drives, https://web.archive.org/web/20140124073650/http://www.seagate.com/internal-hard-drives/desktop-hard-drives/ (click on "Specifications" tab) (archived Jan. 24, 2014).

³⁰ See, e.g. FED_SEAG0004438, at 4447 (Jan. 2015 Product Manual); FED_SEAG0030293, at 30302 (Sept. 2016 Product Manual). It is my understanding that the September 2016 Product Manual was the most recent manual produced by Seagate during discovery in this litigation and is therefore presumably the most recent iteration that has been released by Seagate.

³¹ See July 2012 Storage Solutions Guide, at p.17, available at https://www.seagate.com/files/www-content/product-content/_cross-product/en-us/docs/storage-solutions-guide-sg1351-11-1210us.pdf; October 2012 Storage Solutions Guide, FED_SEAG31474, at 31492; October 2013 Storage Solutions Guide, at p. 31, available at https://www.seagate.com/files/www-content/product-content/_cross-product/en-us/docs/storage-solution-guide-oct-13-ssg1351-14-1310us.pdf.

³² For example, the Data Sheets stated, "Seagate AcuTrac servo technologies delivers dependable performance, even with hard drive track widths of only 75 nanometers."

F. When Seagate First Shipped the ST3000DM001 to Customers, It Knew the Drive's AFR Was Higher than Advertised

- 59. As set forth above, when Seagate first shipped the ST3000DM001, it advertised to customers that the Drive had an AFR of 0.34%, and it also advertised an AFR of <1% on its website and in marketing materials. Seagate subsequently advertised the AFR as "0.34%, <1%" or <1% on its website and in various consumer literature.
- 60. However, a review of Seagate's internal testing documents reveals that the Drive was approved for shipment despite having an AFR that exceeded the specification advertised, and it remained in excess of that specification. Accordingly, Seagate knew that it was falsely advertising the failure rate of the Drive.
- 61. The first iteration of the Drive was approved for shipment on April 28, 2011. As per Seagate's "Product Life Cycle Process" described above, for a Drive to be approved for shipment for sale to customers, a core development team must prepare and submit for approval a Shipping Approval Document ("SAD"). The first SAD document for the Drive was produced as FED_SEAG0026697-26750, and is titled "Grenada SBS SAD Final 4/28/11." Expanding the acronyms in the title leads to "Grenada Seagate Branded Solutions Shipping Approval Document Final 4/28/11".
- 62. Thus, this is the document that was submitted for approval to start shipping the first iteration of the Drive in April 2011. It was approved. The summary page of the SAD is reproduced below.

1	
2	Produc Design Volum
3	
4	
5	
6	
7	
8	
9	
10	
11	
12	
13	
14	
15	
16	6.
17	approved
18	hours. T
19	mere 1%
- 1	1

	actory: Korat		LEXCER	TIONS/ST	FATUS	MET?	
1a	Integration DPPM Goal Achieved	DEMO	RAW	DEMO	PROJ.	X YES	NO
***	$Demo \le 8,000 dppm$	≤ 8k DPPM	10000000	6.8K	N/A	Dist. Com.	
1b	168-Hr DPPM Goal Achieved Demo ≤ dppm	DEMO N/A DPPM	RAW	DEMO	PROJ.	N/A	4
2	MTBF Goal Achieved	DEMO	RAW	DEMO	PROJ.	X YES	NO
-	Demo > 100 k hrs > 100k Hrs			101K	167K	- A TES LINE	
	SBS Mini RDT completed/fit for use		12333		1		
3	Gen 2/3 Product Assurance and Factory Testing Complete - SBS DMT testing and Reliability subset of drive DMT testing			ress of Regres	XYES	NO	
4	Firmware/Compatibility Testing Complete - SBS firmware and compatibility completed/fit for use and All High Risk items fix validated.					X YES	∐ NO
5	Factory Prime Yields meet Phase 0 goals			Product 8n, 2D: 67.8	X YES	_ NO	
6	Process Readiness Audit and Process Verification Test Results approved by Volume Factory and Design Center Includes OA Hardware/Software Readiness and SBS approval					X YES	□ NO
7	Component sources defined on the SSP approval level AE/AB. Exceptions have defined/underpinned closure plans. Qualified Sources can support Master Schedule Requirements.					X YES	□NO
8	Product Stewardship Declaration of Compliance has been issued per Corporate Product Stewardship Certification Process.				X YES	□ NO	
9	Inventory / Material Disposition - Complete roll-up of all Factory and DC pre-SAD config- inventory/WIP/FG and Disposition.				X YES	□ NO	
10	All other exceptions to the CTU Ship Approval Document have been closed.			n Certification SB	X YES	□ NO	
11	Complexity Health Index - Does not deviate from Phase 0 Contract			dex Score = 25 idget = 80	X YES	NO	

Figure 5: Status of Grenada at time of shipping approval (FED SEAG0026699)

- 3. This summary page is significant for a variety of reasons. First, it shows that to be d for shipment to customers, the Drive had to have an MTBF of greater or equal to 100K The summary page concludes that the demonstrated MTBF at the time was 101K hours – a over target.
- However, an MTBF of 100K hours for a hard drive tested with a 2400 POH 64. assumption is equivalent to an AFR of 2.37%. Hence, Seagate's projected AFR requirement upon releasing the Drives was significantly higher than the AFR of 0.34% that Seagate advertised. Likewise, notwithstanding that Seagate considered the MTBF goal to be achieved, the Drive was released with a projected MTBF of 101K hours, which is equivalent to an AFR of 2.35%. This is 7 times greater than the 0.34% AFR that Seagate was advertising to consumers at the time.
- As will be discussed in more detail below, the Drive also had an AFR (a projected first year Weibull) of 7.006%. This is **20 times greater** than the 0.34% AFR that Seagate was

20

21

22

23

24

25

26

- 66. Row 2 in the above graphic also shows a value titled "PROJ" which represents the MTBF that would presumably be achievable by Seagate once all identified corrective actions had been applied. The aspirational projection of 167,000 hours is significantly better than the demonstrated 101,000 hours; however, the projection would nevertheless result in an AFR of 1.43%, or **4 times greater** than the AFR that Seagate was advertising at the time.
- 67. Another important part of this Shipping Approval Document is the "Reliability Summary." The top part of the page is reproduced below.



Figure 6: Grenada Reliability Summary Showing a Large Over-Temperature Problem (FED SEAG0026697, at 26703) (highlight added)

68. Notably, this page indicates that, when the case temperature for the Desktop External Drive³³ was tested, the Drive was 11°C above the temperature limit. It is well known that the reliability of almost all products is a strong function of temperature. Indeed, this is what Seagate has to say on the topic:

³³ As set forth in Seagate's Second Amended Interrogatory Answers, at p.3, the term "Raptor" is a reference to the product marketed as the "Desktop External Drive."

Hard drive reliability is closely related to temperature. By operational design, the ambient temperature is 86°F. Temperatures above 122°F or below 41°F, decrease reliability. Directed airflow up to 150 linear feet/min. is recommended for high speed drives.³⁴

- 69. The SAD indicates that the Desktop External Drive was not approved for release at the time of the SAD document due to temperature and drop test failures.³⁵
- 70. Based upon my industry experience, a temperature issue such as the one identified by Seagate at the time it authorized mass shipment of the Drive would be considered a major problem that would need to be resolved before ever approving *any* configuration for sale to consumers.
 - 71. The next page was also illuminating and is partially reproduced below:

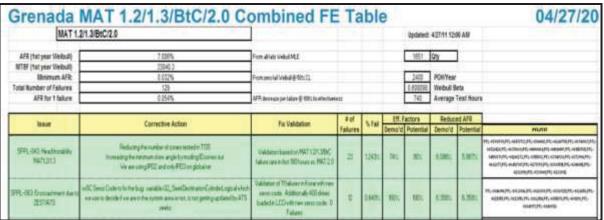


Figure 7: Grenada Maturity Acceptance Testing Combined Fix Effectiveness Table.

Top part of FED_SEAG0026704

- 72. After acronym expansion, the title reads "Grenada Maturity Acceptance Testing 1.2/1.3/BtC/2.0 Combined Fix Effectiveness Table".
- 73. The "MAT 1.2/1.3/BtC/2.0" language indicates that the Drive underwent multiple rounds of testing. If the results of a test did not meet Seagate's maturity acceptance criteria, Seagate would repeat it and assign a different MAT number (or other designator) to it. Thus, at the time of the SAD document, Seagate had to repeat the testing of the ST3000DM001 at least four times, with earlier tests likely preceding "MAT 1.2" (it would be unusual to designate the first test as "1.2"

³⁴ Seagate, Hard disk drive reliability and MTBF / AFR http://knowledge.seagate.com/articles/en_US/FAQ/174791en?language=en_US&key=ka03000000tmWGA AY&kb=n&wwwlocale=en-us (last accessed Oct. 10, 2017).

³⁵ See FED_SEAG0026697, at 26717.

- 74. The table in Figure 8 below lists, among other things, the most common failures (under the "issues" column), the proposed corrective action, the demonstrated and potential fix effectiveness (under the "Eff. Factors" column), and then a computation of the impact that the proposed corrective action will have on the AFR based on the demonstrated and potential fix effectiveness (under the "Reduced AFR" column).
- 75. This table evidences that, based on the results of its reliability tests on 1651 units with an assumed POH of 2400 hours and a Weibull Beta of 0.608098, Seagate concluded that the Drive had a projected AFR of 7.006%. Seagate further projected an AFR of 2.34% once corrective actions were in place to address the identified defects with the Drives. Even with the corrective actions taken by Seagate, the projected AFR remained well in excess of 1%.
- 76. The rest of the page, and the following page, list a plethora of issues, the corrective action, and the validation of the fix. Seagate assigned a "fix effectiveness" to each proposed corrective action (i.e., that the corrective action would work X% of the time) to come up with a Mean Time Between Failures of 101k and a "demonstrated reduced AFR" of 2.34%. These numbers are shown in the figure below, which is the lower part of chart.

		Total Number of Falls	129	, margaret	Redu	ced AFR !	2.54%	1.42%	
Veal Very			11	1054%	04	81	7,800%	7.008%	F5-0001
Single Bit Miccompany	MANAGOR PARTOQU		-1	80540;	Di,	100%	7,000	6.952%	H) majo
SPPL-072 Cetrack Wide due to routlineer 2017 convotion teal option area	Person 251 Taje van de gyten trakt. Baleire TAPER, 251 DEAR, PESENKE, 2014 (IIII. BHARE, 251 DATA, OVERAN) - (III. BHARE, 251 DATA, OVERAN). MEHRE TAPER, 2537 MARK, TRACIO - (III. BHARE, 2537 DATA, DVERAN). MEHRE TAPER, 2537 MARK, TRACIO - (III. BHARE, 2537 DATA, DVERAN). Palsunet Seno Code v		1	8.05400	ės,	30%	7300°C	8.90m	Milesacca
PPL-07: Head horability - MAT 25	DETCRIOR in Fluntime, Implementation in PCD Int.		- 1	8054%	th.	Mr.	7.50E%	7.000%	PS-HURT
SPPL478 Faled to Spare Error -	lasua not repueble in Peli or SE. Pendogria		1	60845	On.	n.	7,00%	7.698%	PS-H-DTH
PFL-069: Mosed Delect - MAT 2.9	Implement hall DOME van in CFS. Implementation date ev48		1	6884%	Di.	800	7.000%	1825	75,41994
PPL 651 BlacPES at Quarter Track Position 6 VCAT Peul	DCLM changes to 109 Change servicities south to map out west as defects Target code helease are	Talitating PFL ISST with next code EFCF in Figure	1	60540;	n	90X	2.000%	LMts	PE HINCH

DECL. OF ANDREW HOSPODOR ISO CLASS CERT. - 22 CONTAINS MATERIAL DESIGNATED AS HIGHLY CONFIDENTIAL

Case No.: 3:16-CV-00523 010581-11 997236 V1

Figure 8: Lower part of chart showing MTBF of 101K / 167K hours and a corresponding AFR of 2.34% / 1.43% (FED_SEAG0026705).

77. Because the above table was contained in the SAD document for the ST3000DM001, which authorized the Drive for release and shipment, it shows that the Drive was released with an AFR of 2.34%, which is approximately **6.9 times greater** than the advertised AFR of 0.34%, and approximately **2.4 times greater** than an AFR of <1%.

78. The second item in the "Reduced AFR" row, 1.43%, is the "potential reduced AFR." This was a projection of the lowest possible AFR that could be achieved based on the potential effectiveness, rather than the demonstrated effectiveness, of the corrective actions. In other words, it is an aspirational projection. Thus, Seagate projected that it could not possibly meet the advertised AFR of 0.34%, or even an AFR of <1%, with the fixes it devised. But, Seagate released the Drives anyway.

79. One of the failures that is listed on the above chart is "head instability," which accounted for 23 failures out of 129 total failures and was the most prevalent failure type. The magnetic recording heads must be stable before a drive enters mass production. Contaminants or even lubrication smeared across the platter can pile up on the air bearing surface ("ABS") of the head. This leads to increased heat and increased flying height (the distance between the ABS and the platter) that destabilize the head and may induce errors in writing and reading data. This is significant because head-related failures, in addition to contamination, was a recurring issue with the Drives.

- 80. Approximately six months after the release of the SBS Drives, Seagate released the OEM and "disty" Drives. In doing so, it produced another SAD document, which was titled "Grenada SAD Approval 10/18/11."³⁶
- 81. This document contains the same type of table as depicted in Figures 8 and 9. Like the previous table, it contains the results of reliability testing conducted with an assumed POH of 2400 hours. It shows that Seagate tested a population of 1360 drives, and the testing revealed that the first-year AFR for the Drive was actually 2.621%, which is approximately **7.7 times** greater than an AFR

³⁶ FED_SEAG0026839.

82. Among the top failures were "degraded head" and "particle induced media damage." Recording heads degrade mechanically by becoming unstable and coming into contact with the platter. This is commonly known in the industry as a "Head Crash". Each time an unstable head impacts the platter, the lubrication can pile up on the air bearing surface, the head can get hotter due to friction, and it can render areas of the platter defective for storing data.

G. The AFR of the ST3000DM001 Remained Higher than Advertised

83. Subsequent internal Seagate testing demonstrates that the ST3000DM001 continued to have an AFR greater than that advertised by Seagate, even as the Drive was migrated from the Grenada Classic to subsequent iterations. According to the SAD document for the GrenadaBP, testing conducted on April 12, 2012 revealed a first-year AFR of 2.942% and a "demonstrated reduced AFR" of 2.0%. As discussed previously, Seagate's website advertised the AFR of the ST3000DM001 as "0.34%, <1%" between April 2012 and January 2013 (as well as earlier in the April 2011 Product Manual). Accordingly, Seagate released the GrenadaBP with a first-year AFR that was **8.65 times higher** than the advertised 0.34%, and a reduced AFR that was **5.88 times higher**. Moreover, the "potential reduced AFR" was also well in excess of the advertised failure rate, at 1.22%.

Case No.: 3:16-CV-00523 010581-11 997236 V1

³⁷ See GrenadaBP SBS SAD Declare April 18, 2012, FED_SEAG0026867, at 26887.

³⁸ Subsequent testing of the Grenada BP, performed on May 14, 2012, revealed a first-year AFR of 2.917% and a reduced AFR of 0.98%, both of which were significantly greater than the 0.34% advertised by Seagate. *See* GrenadaBP ECQ Approved Final 6-5-12, FED_SEAG0026751, at 26783. In addition, head-related failures continued to be a problem. For instance, on page DECL. OF ANDREW HOSPODOR ISO CLASS CERT. - 24 CONTAINS MATERIAL DESIGNATED AS HIGHLY CONFIDENTIAL

12

13

14

15

16

17

18

19

20

21

22

23

24

25

26

27

- 85. Since this testing was conducted eight months after the Grenada OEM and "disty" Drives were released, the 3.436% AFR reflected the actual AFR of the Drives purchased by endusers. In addition, Seagate projected a "demonstrated reduced AFR" of 2.35%, meaning that even taking into account the planned corrective actions that Seagate devised for the Drive from their ORT, the Drive's AFR would still be **6.9 times greater** than the advertised AFR going forward. Seagate's AFR went from 2.34% to 2.621% and up to 3.436% within eight months after the start of mass production. This is a strong indication that the Drives were wearing out prematurely.
- 86. In addition, the Drive was still suffering from head-related failures, which accounted for 19 of the 81 failures that occurred during testing. Simply stated: one quarter of the Drive failures were related to the recording heads.
- 87. The differences between the AFR demonstrated in internal Seagate testing and the advertised AFR are important to consumers because, unlike most other consumer electronics, if a hard drive fails, the consumer doesn't just lose a device they also lose their valuable data: the

FED_SEAG0026757 of the ECQ document, which is a reliability summary, "head instability" is identified as an issue.

³⁹ See GrenadaBP ECQ Approved Final 6-5-12, at FED_SEAG0026785-86.

⁴⁰ See GrenadaBP ECQ Approved Final 6-5-12, at FED_SEAG0026785-86.

8

9

10

1112

13

14

1516

17

18

19

2021

22

2324

25

2627

28

pictures, email messages, files and programs. Data recovery services can run into the thousands of dollars.

- 88. At the time, an AFR of <1% was considered to be a highly desirable and oft-quoted specification in the storage industry. In my professional experience, <1% is the most frequent AFR specification that I have seen advertised by hard drive manufacturers during this period. Indeed, Seagate touted its desktop, laptop, enterprise, and video storage hard drives as having AFRs of <1% in consumer-facing materials (either by quoting the AFR as "<1%" or a specific figure that was <1%).
- 89. A storage device with an AFR >1% would be undesirable because it would not be as reliable as a drive with <1% AFR. Customers care about data, and an AFR of >1% represents an increased opportunity for data loss, when compared to Seagate's competitors. To this day, an AFR of <1% remains a desirable specification quoted by hard drive manufacturers.⁴²

H. Seagate's Reliability Testing Underestimated the True AFR of the Drive

- 90. In addition to the fact that Seagate's own testing revealed that the AFR was higher than advertised, Seagate's test results underestimated the true AFR of the ST3000DM001. In projecting the AFR, Seagate utilized a Weibull beta value that reflected the assumption that the failure rate of the Drive would decrease with time, but the failure rate actually increased from an AFR of 2/34% to 2.61% to 3.436% within just eight months after the start of mass production.
- 91. The Weibull distribution is widely used in reliability analysis. In its most general form, the Weibull distribution is a three-parameter distribution. However, a two-parameter version is commonly used. Of the three parameters, the most important parameter is known as beta, or β.
- 92. Beta has a fundamental impact on projected failure rate. The Weibull failure rate as a function of beta is shown below:

⁴¹ See July 2012 Storage Solutions Guide, at p.17, 21, 27, 35, available at https://www.seagate.com/files/www-content/product-content/_cross-product/en-us/docs/storage-solutions-guide-sg1351-11-1210us.pdf.

⁴² See How drive reliability is measured and the MTBF of WD drives, Western Digital, https://support.wdc.com/knowledgebase/answer.aspx?ID=665 (last accessed November 3, 2017) (stating that the AFR of Western Digital hard drives is "less than 0.8%.").

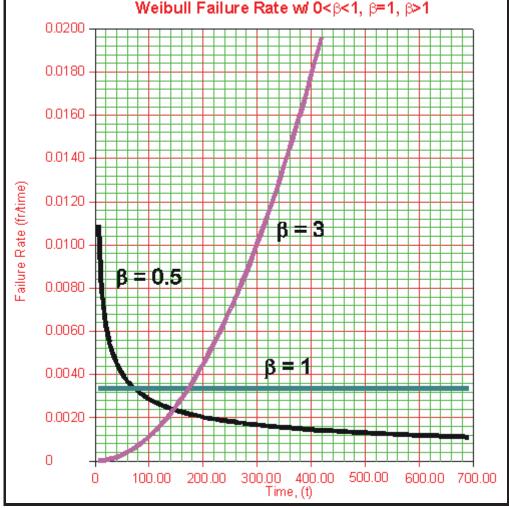


Figure 9: Weibull Failure rate as a function of beta

- 93. This graph in Figure 9 is widely referred to as a "bathtub curve." It shows that a β of less than 1 is indicative of a population with a failure rate that decreases over time. This is often referred to as "infant mortality," because defective products fail quickly and are thus weeded out, leaving a reduced failure rate as time goes on. A β of around 1 indicates a constant failure rate and would reflect the useful life of a product with random failures. Finally, a β of more than 1 indicates that the failure rate is increasing with time and that the product is wearing out.
- 94. As discussed in Section F, Seagate computed a β of 0.608098 (i.e. a value of less than one) for the release of the Drive to Seagate Branded Solutions customers. Seagate also computed a β of less than one for all of the other reliability testing it conducted. This β value represents an assumption that the Drive will have a declining failure rate over time.

95. However, Seagate's testing was flawed because the failure rate of the ST3000DM001 did not decline with time, but rather increased from an AFR of 2.34% to 2.621% to 3.436% within just eight months after the start of mass production. Seagate should have used a β value greater than 1, rather than 0.608098, to accurately represent their failure rate.

96. In June 2012, nearly a year after the initial release of the Drive and 12 days after the results of ongoing reliability tests showed a greater-than-advertised AFR, Andrei Khurshudov, Ph.D, Senior Director of Cloud Storage Quality Engineering for Seagate, wrote a report that seriously questioned the validity of Seagate's modeling. An email introducing the report is shown below:

From: Andrei Khurshudov <andrei.khurshudov@seagate.com> Sent: Saturday, June 16, 2012 3:57 PM Sai S Varanasi <sai s.varanasi@scagate.com> To: Subject: please take a look Attach: Return trends analysis and product wearout.ppt Hi Sai. I have finished this study and would like you to preview it before I release it. I consider it pretty important because it changed my personal view on several things... Hopefully, it will have similar effect on others. Please let me know what your thoughts are. Possibly, this summary could be used to apply some extra pressure on engineering in terms of supplying more margins to our products... Executive summary is in slide 10. The bulk of all materials used is in the backup. Look forward to your feedback. I have discussed this with John Morris and verified fundamental concepts with Satya. They both OKed this summary (with some changes, which I made), thanks! Regards, Andrei Khurshudov, Ph.D. Sr. Director Cloud Storage Quality Engineering Seagate Technology

Figure 10: Email from Andrei Khurshudov (FED_SEAG0001817) (highlights added)

1	
2	
3	
4	
5	
6	
7	
8	
9	
10	
11	
12	
13	
14	
15	

17

18

19

20

21

22

23

24

25

26

27

28

97. Dr. Khurshudov shared his report and sought feedback and approval from at least five people at Seagate, including the Vice President of Quality, Michael Crump, who was Dr. Khurshudov's superior.⁴³

98. As shown in Figure 10, above, Dr. Khurshudov concluded that his summary "could be used to apply some extra pressure on engineering in terms of supplying more margin to our products " (ellipsis in original). To see why Dr. Khurshudov would make such a critical statement of Seagate's design practices, it is necessary to turn to the details of his report, which was produced as FED SEAG0001851-81.44 The report is in the form of a PowerPoint presentation and is titled "Product Failure Rate Trends and the Role of Workload Stress." The second slide of the presentation is reproduced below.

Objectives

- We always presume that the failure rate of our products declines over time (as the infant mortality population fails)
 - The above assumption corresponds to Weibull β<1, which we use in our calculations and AFR/MTBF projections (β=0.55 is typically used)
 - Therefore, it is presumed that products will improve reliably over time
 - Products with β>1 are typically suffering from "wearout" phenomenon, which is highly undesirable
- The main objective of this study is to understand if the above assumptions are correct and how the higher workload stress is impacting the above dependencies
- Also, since the workload stress will only increase with time, this could allow us to make some future predictions

Figure 11: Objectives of Dr. Khurshudov's analysis (FED_SEAG0001852)

CONTAINS MATERIAL DESIGNATED AS HIGHLY CONFIDENTIAL Case No.: 3:16-CV-00523 010581-11 997236 V1

⁴³ Khurshudov Dep. at 131:5-17, 137:1-138:6.

⁴⁴ It is my understanding that this was the most recent version of Dr. Khurshudov's report that Seagate has produced. Dr. Khurshudov emailed the report to a Seagate manager on June 17, 2012. DECL. OF ANDREW HOSPODOR ISO CLASS CERT. - 29

9 10

8

11 12

13

14

15

16 17

18

19

20 21

22 23

24


25 26

27

99. Dr. Khurshudov is thus examining a fundamental assumption that Seagate makes about the reliability of its drives and how they fail over time. Note the references to the Weibull distribution and an assumption that β is less than 1, with a typical value of 0.55 (recall that the Weibull β for the ST3000DM001 when it was first approved for release was 0.608098, and it was less than 1 for every subsequent test).

After providing background information about what the different β values mean (i.e. 100. increasing, decreasing, or constant failure rate), Dr. Khurshudov explained his methodology using data from eCube, the Seagate's database that stores information about returns. Importantly, his analysis covered a typical period of 36 months' worth of shipments. Dr. Khurshudov then presents a chart showing how each generation of product is exhibiting failures rates consistent with β increasing to and possibly surpassing a value of 1. This chart is shown below.

Product Evolution Example

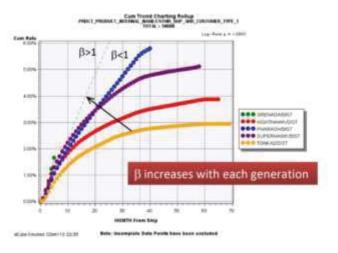

- The above chart offers a good example of how the Weibull beta is shifting from lower value to β=1 over several generations of our Disti PS products
- While Tonka and Nighthawk was showing the behavior we expected to see with β<<1, Superhawk cum failure rate was closer to straight line, and Pharaoh's trend *looks almost straight* now ($\beta = 1$)
- We should wait until we could make a conclusion about Grenada
- Need more data analysis to confirm this observation

Andrei Khurshudov@seegate.co

9

15

28

103.

Figure 12: Dr. Khurshudov showing how β is changing with drive generation (FED SEAG0001857)

101. Grenada (in green) was the most recent generation and appears to have had the worst performance (largest β). Note, however, that Dr. Khurshudov was not comfortable drawing conclusions about Grenada until he had more than just six months data, but it appears that he did not later update the report. Notwithstanding this, the graph shows a clear progression from β <1 to β >1, with the data points of the Grenada falling in the β >1 range.

102. Dr. Khurshudov provides additional information on wear out modes and then produces his conclusions, which are shown below.

Conclusions

- About 50% of our products do not follow an expectation of declining failure rate (or, β <1) with time. 30% of products show a signature of wearout.
 - This could serve as an evidence that our products don't have enough design margin
- It is possible that there is a correlation between the amount of workload stress and the product's propensity to show constant failure rate or wearout
 - MC and NL products, operating under higher workloads, show many more signatures of constant failure rate or even wearout than less stressed NS and SBS products
 - High workload seems to prevent failure rate from declining over time
 - More "focused and formal" analysis is needed to confirm this dependence
- Future will bring higher workload stress and, thus, higher risk of wearout
- Also, considering that we observe β <1 in most of our internal tests (RDT, ORT), one could conclude that these relatively short tests do not necessarily predict well the long-term product reliability behavior
- The Weibull β values assumptions we are using for AFR/MTBF projections might need to be revisited upward to, possibly, $\beta = 1$.
- Longer-term reliability tests (~1 Year) might need to be introduced to gain more confidence in reliability projections

Figure 13: Dr. Khurshudov's conclusions (FED_SEAG0001860)

germane. First, Dr. Khurshudov concluded, "About 50% of our products do not follow an

Whilst all of the conclusions are important, there are few that are particularly

expectation of declining failure rate (or, β <1) with time . . . This could serve as an (sic) evidence that our products don't have enough design margin."

This was a general statement about Seagate's products and was not aimed at the ST3000DM001 in particular. However, the Backblaze reports showed that certain Seagate products, and the ST3000DM001 in particular, were not as robust as the competition. For example, a report published by Backblaze in 2015 revealed that the ST3000DM001 Drives deployed at Backblaze experienced shockingly high failure rates that were substantially higher than the other 3TB hard drives Backblaze used. Specifically, the ST3000DM001's overall failure rate was 28.46% from 2013 to 2015, with a huge spike from 10.35% to 43.08% between 2013 and 2014 (most of the ST3000DM001s used at Backblaze were deployed in 2012). The 3TB drive with the second highest failure rate was the Western Digital Red, at 7.65%.

105. In short, it is my professional opinion that, as to the ST3000DM001, Dr. Khurshudov's statement was correct.

106. Next, Dr. Khurshudov concluded:

Also, considering that we observe β <1 in most of our internal tests (RDT⁴⁷, ORT⁴⁸), one could conclude that these relatively short tests <u>do not necessarily predict well the long-term product reliability behavior</u>. (Emphasis in original.)

107. This acknowledges that Seagate used predictive tests that were overly optimistic about the reliability of Seagate hard drives.

DECL. OF ANDREW HOSPODOR ISO CLASS CERT. - 32 CONTAINS MATERIAL DESIGNATED AS HIGHLY CONFIDENTIAL Case No.: 3:16-CV-00523 010581-11 997236 V1

⁴⁵ See What Can 49,056 Hard Drives Tell Us? Hard Drive Reliability Stats for Q3 2015, Backblaze (Oct. 14, 2015), https://www.backblaze.com/blog/hard-drive-reliability-q3-2015 (hereafter "October 2015 Report"); FED_SEAG0025567, at 25571 (internal Seagate document stating that the AFR of the ST3000DM001 at Backblaze was 43.10%). See also CSI: Backblaze – Dissecting 3TB Drive Failure, Backblaze (April 15, 2015), https://www.backblaze.com/blog/3tb-hard-drive-failure; How long do disk drives last?, Backblaze (Nov. 12, 2013), https://www.backblaze.com/blog/how-long-do-disk-drives-last/.

⁴⁶ See October 2015 Report, supra n.40.

⁴⁷ RDT = Reliability Demonstration Test

⁴⁸ ORT = Ongoing Reliability Testing

1	
2	

45

67

8

10

9

1112

13

14

1516

17

18

10

19

2021

22

23

24

2526

27

- 108. Dr. Khurshudov also concluded, "Longer-term reliability tests (~1 Year) might need to be introduced to gain more confidence in reliability projections." Seagate tested its hard drives to around 1008 hours, which is six weeks.⁴⁹
- 109. Additionally, Dr. Khurshudov concluded that, "The Weibull β values assumptions we are using for AFR/MTBF projections might need to be revisited upward to, possibly, $\beta = 1$." I agree with Dr. Khurshudov that the assumed The Weibull β values should have been changed to reflect the projected and observed reliability of the Drives.
- 110. A prior version of Dr. Khurshudov's report reached an even stronger conclusion. This version, which was attached to an internal Seagate email from Dr. Khurshudov dated June 1, 2012, 50 stated that "The Weibull β constant assumptions we are using for AFR/MTBF projections might need to be revisited upward to, *at least*, $\beta = 1$." 51 Dr. Khurshudov changed this conclusion from "*at least*, $\beta = 1$ " to "*possibly*, $\beta = 1$," and made some of his other conclusions "more careful and less certain" to avoid "conflict" with his colleagues at Seagate who might have taken exception to him criticizing their testing methods too bluntly. 52
- 111. In any event, Dr. Khurshudov's call to increase the Weibull beta value used for projecting AFR indicates that Seagate's method of calculating failure rates underestimated the rate at which Seagate products incurred wear-out failures.⁵³

⁴⁹ See Almgren Dep. 187:24-188:17.

⁵⁰ See FED_SEAG0001985.

⁵¹ See FED_SEAG0001986, at 1993.

⁵² See Khursudov Dep., at 164:7-165:22.

⁵³ Other internal documents from 2012 acknowledge that Seagate's design and reliability validation processes failed to ensure that products met service life goals and customer expectations. *See* FED_SEAG0055831; FED_SEAG0056341; FED_SEAG0068026; FED_SEAG0056259. In an internal proposal titled "5-year BiC service life Strategic Reliability Initiative," Seagate specifically acknowledged it had a "Reliability Challenge" and considered making specific changes to, among other things, raw MTBF metrics, design margin testing, life testing and validation, SBS Design Maturity Test requirements, defective parts per million demo quantity requirements, and the firmware release process. FED_SEAG0055831, at 55838, 55848. In that same document, Seagate identified "NHK particulate contamination," "Head instability," and "DSP tolerance to MBA" as the main problems with the Grenada. FED_SEAG0055831, at 55841.

112. It appears that Seagate did not implement reliability tests for the ST3000DM001 that were significantly longer than six weeks, nor did it utilize a β value of one or greater. The below figure is part of a table reporting the results of reliability testing on the Grenada BP2, which was released on or around January 15, 2014.

AFR[1st year Weihull] MTHF [1st year Weihull] 20r PR (2nd Year Weihull) 30r PR (2nd Year Weihull) 40r PR (4th Year Weihull) 50r PR (5th Year Weihull)	1.039% 229765 1.363% 1.598% 1.788% 1.951%	Free of Sub-Weshell M.E.				1058 14 2400 0.394 1197 01/14/14		ar	Seagate (C)
			1	Mode		T.%	Reduced AFR		
bene	Corrective Action	Fix Validation	Qty	AFR	Demo'd	Percental.	Denot	Potential	SN/TTE
furfick and Contamenation Ballaction glass for FOT limes France Place ICS (558758)	CS EE ado self cleaning ADV solds than DDFE grape particle relaction(Aug. DDFE grape particle relaction(Aug. DDFE grape particle relaction(Aug. DDFE days for OSS. Band Share And Couning Comp problem (Voltage State) Environmental Doing in a New and other season to 1900s and remove particles for DSF Docket with version of the DSF Docket with version to commission particles for ISS. De through the residual particles for ISS.	180		0.4%	3	198.	54%	0.6%	(M18000TR- 79) [M3600078- SEE] (M1800072-7) [JR80000C-48] (JA200ER- E29) [JR20072T-604]
hels - Compane Etrur	in Setaat		1	0.07%	-		0.07%	0.07%	[34002748 - 388]
Head Improvements with Stability 2 and test	Stability 2 and test enhancements	T :	1.	0.07%		40%	160%	Dork	[5000E4F-164]

Figure 14: Grenada BP2 reliability test results (FED_SEAG0057277, 57324)

- 113. Here, Seagate tested 1058 Drives for an average of 1197 hours, which is approximately seven weeks, and the Weibull β was 0.394. Unlike prior reliability testing, Seagate projected the AFR for the first through fifth years, rather than just the first year, and the AFR increased from 1.039% in the first year to 1.951% in the fifth year.
- 114. I cannot reconcile this increasing failure rate with the use of a Weibull β of 0.394, because a β of <1 reflects a decreasing failure rate. The fact that Seagate came up with a β of >1, projecting an increasing failure rate, further suggests that Seagate's testing was deeply flawed. In any event, the increasing AFR demonstrates that the ST3000DM001 was projected to have significant wear-out failures within its five-year expected service life. If a β of greater than one had been used, it is likely that the projected AFR would have been even higher.
- 115. The increasing failure rate also indicates that the first-year AFR projections used in the previous reliability tests substantially underestimated the true AFR of the ST3000DM001 over its

expected life. Projecting only the first-year AFR is appropriate when the failure rate of a product decreases over time, but that was not the case with the ST3000DM001.

- 116. Notably, the top "issue" in the above chart is related to contamination, and the third issue is head-related.
- 117. In summary, since the failure rate of the ST3000DM001 increased with time, the Weibull beta of <1 that Seagate used in projecting the AFR of the Drive was not correct. The Weibull beta should have been >1. This, in conjunction with the fact that Seagate only calculated AFR for the first year of Drive use until the Grenada BP2 was tested, means that Seagate underestimated the AFR of the Drive. Accordingly, the true AFR of the Drive was likely appreciably higher than the values projected by Seagate during the pre-release and post-released testing discussed above. Moreover, contamination and head-related failures continued to plague the ST3000DM001 at the time the GrenadaBP2 was released.

I. The ST3000DM001 was Unstable and was Released Prematurely

118. The ST3000DM001 was not only sold by Seagate with an AFR that was significantly higher than what Seagate advertised, but the Drive was unstable, defective, and was released prematurely. Seagate was aware of such, evidenced by the Drive's low factory yield, its large number of engineering and firmware changes, its repeated shipping holds, its escalating reliability issues, and internal Seagate communications, among other things.

1. The ST3000DM001 Had a Very Low Yield

119. The term "yield" refers to the number of good, shippable units that are produced at a factory, as opposed to units that are discarded or sent to be reworked because they were discovered to be defective or did not otherwise meet quality control standards. There is a relationship between factory yield and reliability; a low factory yield is indicative of an unreliable, defective product. When producing millions of drives, a factory yield below 90% is a cause for concern because humans are required to diagnose, repair and rework hundreds of thousands of defective disk drives.

120. Factory yield impacts a manufacturer's bottom line, because if they are producing hard drives that cannot be shipped, they lose money. Accordingly, yields are something that manufacturers pay close attention to. Given the relationship between yield and reliability, the low factory yield of the ST3000DM001 therefore further demonstrates that Seagate was aware that the ST3000DM001 was unreliable.

121. For example, page FED_SEAG0026731 from the "Grenada SBS SAD Final 4/28/11" document, reproduced in part below, is telling.

Grenada 37 Yield Improvement Plan	improvement.	Fallog	When	NAME	WATA	WWIS	11725	WA2	WAL	WW25	WAS	WAL	1945	WAS	MATE	MINE	WY4	WAT	MAG	選挙	William	WHST	limit	WW6	WWX	ш.
C 1284 Heater Connections when result of their in results (PFC)	125	EM.	Mit						1.25%																	Г
ET THE SHOWEN STORE IS THE SECOND	0.4%		MIL.	§ 73					2.4%		. 3					2							-3	1	- 2	П
25 1000 Deale DIC payers from Lawer (FT)	10	113	WAR						10%													П			- "	Г
SE 150's TS4 anto register minut sharps (SF2)	US	ш	WAG	8 /	18							13%											100	- V	- 17	г
EAW Spec	-40	1	With	- 1								-/th:														\Box
ATNOTE Space	-0%		WATE									32%														\Box
Stability Spec	- 25		WAY I	Q 1/-								25											- 0	- 9		г
Title ES/V input meet (2018)	425		WAS											4%								П				г
Water EAST Trappers and 1999-11	435		Till 1		- 23																		425			$\overline{}$
SEE Male Tomoran Pol PSS 2	- A		WAS	-	- 0	- 0															%			- 1		$\overline{}$
SPALS (SPALS When on SPALS Seator) house	- PA		WAY											$\overline{}$							95					\vdash
Pilina	N.		Maid	S. 10	100	- 9		- 1		-					1											
Terit					Н		-		Н	Н			Н	Н			-	_			Н	Н	Н			\vdash
Gerada IT Adap Yeld	_	_	7	415	47%	455																				
LRF Greech 17 Butget			-				XE.	3561	485%	41.3%	075	4315	63.25	\$6.6%	45.1%	4573	在抗	0.%	67.7%	48.65	GB	4875	315	31.75	52.3%	575
Grenado IT Projecto d Visid			_	415	475	部	42%	435	惠	胀	#	79%	29%	3/8	36	365	36	36	3/5	3/3	276	525	355	捌	*	景
																		15			S	eaç	jate	.((١)

Figure 15: Grenada 3TB Yield Chart (FED_SEAG0026697, at 26731)

122. This chart lists the "Grenada 3T Actual Yield" for the ST3000DM001 for various "workweeks" (abbreviated "WW"), and it indicates that the highest "actual yield" achieved for the ST3000DM001 at the time of the Grenada SBS SAD document was only 43%. This extremely low yield means that half the Drives that Seagate produced required rework or correction action. Furthermore, a 43% yield indicates that the product was immature, highly unreliable and should not have been released until a substantially higher factory yield was achieved.

- 123. In addition, the highest yield that Seagate anticipating achieving in the 23 weeks reflected on the graph (listed as "Grenada 3T Projected Yield) was a mere 56%. This is still an unacceptable yield from a reliability standpoint and requiring nearly half the drives to be reworked.
- 124. The "Grenada SAD Approval 10/18/11" document also contains a page with yield information for the ST3000DM001, which is reproduced in part below.

DECL. OF ANDREW HOSPODOR ISO CLASS CERT. - 36 CONTAINS MATERIAL DESIGNATED AS HIGHLY CONFIDENTIAL

Case No.: 3:16-CV-00523 010581-11 997236 V1

	3
	4
	5
	6
	7
	8
	9
1	0
1	1
1	2
1	3
1	4
1	5
1	6
1	7
1	8
1	9
2	0
2	1
2	2
2	3
2	4
2	5
2	6
2	7
2	8

2

		Mee	eting Cu	rrent LR	Р			
3TB Task	54.2	54.5	54.7	54.7	54.7	60	60	60.4
3TB LRP	54.2	54.5	54.7	54.7	54.7	56.0	56.0	56.2
6H Yield	56.0	56.0	63.9	65.0	65.0	65.0	68.0	68.5

Figure 16: Portion of chart from page entitled "Grenada YIP [Yield Improvement Plan]

Migration" (FED_SEAG0026839, at 26856)

125. This chart contains yield information for the ST3000DM001 in the "6H Yield" row,⁵⁴ and it reveals that, over the course of several weeks, the yield of the ST3000DM001 was, at most, 68.5%. While this is an improvement on the previous yields, it is still very low, and means that nearly a third of the Drives Seagate produced required rework or corrective action. Thus, although six months had elapsed since the first release of the ST3000DM001, Seagate was unable to increase first pass yields to a level in the 90-99% range more typical of the storage industry.

126. As discussed above, on April 18, 2012, Seagate authorized the release of the GrenadaBP. In the "GrenadaBP SBS SAD Declare April 18, 2012" document, on FED_SEAG0026872, the yields for the 3TB Grenada BP over a ten-week period were between 56.6% and 71.8%. Moreover, this document listed the yields for the 3TB Grenada Classic as between 68% and 70.4%. At this point, Seagate is reworking or taking correction action on at least a quarter of the Drives they are producing.

2. The Engineering Change Logs Also Evidence that the Drive Was Unstable and Shipped Prematurely

127. Seagate produced Engineering Change Request (ECR) data for the Grenada Classic in the form of a spreadsheet. This spreadsheet is a log of all of the changes made to the electrical and mechanical components of the Drive, among other things. An example of what the data looks like is shown below:

⁵⁴ "6H" stands for six heads, which was the number of heads the ST3000DM001 had.

1	
2	
3	
4	
5	
6	
7	
8	
9	
10	
11	
12	
13	
14	
15	
16	
17	
18	
19	
20	
21	
22	
23	
24	
25	

27

28

A	A	E	F	G	H	1	1	M	N	0
1	Name	Project Name	Disposition	Priority	Reason	Change Duration	Descriptio	n (WbsDe	escription)	4
2	ECR0120493,	SEA GRENADA CC	Approved	Serious Priority	Initial Release	Permanent	***NOTE -	3/2/10 R	emoved al	ternate PCBA
3	ECR0123019,	SEA GRENADA CC	Approved	Serious Priority	Initial Release	Permanent	ECR create	s evaluat	ion CCs fa	r Grenada 1D,
4	ECR0123457,	SEA GRENADA CC	Approved	Serious Priority	Commonality	Permanent	REASON F	OR CHAN	GE: There	is a bug in the
5	ECR0124045,	SEA GRENADA CC	Approved	Serious Priority	Initial Release	Permanent	Support FI	S tracking	of 900 an	d 750GB capac
6	ECR0125047,	SEA GRENADA CC	Approved	Serious Priority	Initial Release	Permanent	***			
7	ECR0125054,	SEA GRENADA CC	Approved	Serious Priority	Allow Purchase/Build of Eva	Permanent	Structure (GRN13 an	d GRN15 P	CBAs to CCs a
8	ECR0126175,	SEA GRENADA CC	Approved	Serious Priority	Allow Purchase/Build of Eva	Permanent	Revise the	followin	g -997 CCs	9GL16C-997
9	ECR0128201,	SEA GRENADA CC	Approved	Serious Priority	Allow Purchase/Build of Eva	Permanent	Adding lat	est relea	sed GRN15	and GRN16 P
10	ECR0128308,	SEA GRENADA CC	Investigate	Serious Priority	Allow Purchase/Build of Eva	Temporary	CANCELED	BY FACT	ORY - NO L	ONGER NEEDS
11	ECR0128512,	SEA GRENADA CC	Approved	Serious Priority	Document update	Permanent	***NOTE:	PREREQU	ISITE ECRO	128511 TO UP
12	ECR0129117,	SEA GRENADA CC	Approved	Serious Priority	Inactivate CCs	Permanent	SEA GREN	ADA CC	Due to out	of order 3 cha
13	ECR0129310,	SEA GRENADA CC	Approved	Serious Priority	Document update	Permanent	For the fol	lowing C	Cs: 9YN162	-999 9YN164
14	ECR0130185,	SEA GRENADA CC	Approved	Serious Priority	Change Status of Bi	Permanent	Per Grena	da Progra	m Manage	ment, change
15	ECR0131159,	SEA GRENADA CC	Approved	Serious Priority	Initial Release	Permanent	Initial Rele	ease of 10	HDD/PCB	A drawing, DO
16	ECR0131485,	SEA GRENADA CC	Approved	Critical Priority	Initial Release	Permanent	Grenada S	BS initial	release 1,	2 & 3TB witho
17	ECR0132000,	SEA GRENADA CC	Approved	Serious Priority	Label Update	Permanent	This ECR u	pdates th	e Grenada	Std product I
18	ECR0132124	SEA GRENADA CC	Approved	Critical Priority	Customer Unique Code CC	Permanent	BLANKET A	APPROVA	LREQUEST	ED - WILL USE
19	ECR0132316,	SEA GRENADA CC	Approved	Serious Priority	Document update	Permanent	Revise 9Y	1164-568	since "IV_	SW_REV" has
20	ECR0132317,	SEA GRENADA CC	Approved	Serious Priority	Customer Unique Code CC	Permanent	BLANKET A	PPROVA	LREQUEST	ED!
21	ECR0132566,	SEA GRENADA CC	Approved	Critical Priority	Consume Inventory	Temporary	BLANKET /	PPROVA	L REQUEST	ED!
22	ECR0132567,	SEA GRENADA CC	Approved	Serious Priority	Initial Release	Permanent	Grenada D	isty BOM	s initial re	lease 9YN166-

Figure 17: Example of ECR data, FED_SEAG0027240

128. Figure 17 shows some of the key fields including the ECR's disposition, priority, reason for issuance, its duration (permanent / temporary) and its description. Note that I have hidden some fields that are of lesser importance. The following table summarizes the frequency and type of ECRs that were generated.

	Count	Percentage
Total number of ECRs:	1023	
ECR's that are minor	3	0.3%
ECR's that are serious	964	94.2%
ECR's that are critical ECR's that are	40	3.9%
emergency	16	1.6%
ECRs that are permanent changes	805	78.7%
ECR's that are CC	416	40.7%
ECR's that are electrical ECR's that are	151	14.8%
mechanical	456	44.6%
ECR's that are approved ECR's that are	956	93.5%
disapproved	11	1.1%
ECR's that are 'None' ECR's that are	33	3.2%
'investigate'	23	2.2%

DECL. OF ANDREW HOSPODOR ISO CLASS CERT. - 38 CONTAINS MATERIAL DESIGNATED AS HIGHLY CONFIDENTIAL Case No.: $3\!:\!16\text{-}CV\text{-}00523$ 010581-11 997236 V1

1
2
3
4
5
6
7
8
9
10
11
12
13
14
15
16
17
18
19
20
21
22
23
24
25
26
27

	Count	Percentage
CC ECRs after product		
release	382	91.8%
Electrical ECRs after		
product release	54	35.8%
Mechanical ECRs after		
product release	283	62.1%
All ECR's after product		
release	719	70.3%

Figure 18: Summary of Grenada Classic ECR Data

- 129. Below I list some noteworthy observations from Figure 18:
 - a. 70.3% of ECR's occurred after the Drive was released for mass production
 - b. Almost all ECR's were at least "serious."
 - c. Most ECRs were approved.
 - d. 78.7% of ECRs were marked as permanent. The remaining 21.3% of the ECRs were called "TEMP DA" or "Temporary Deviation Authorization" by Seagate.
 - e. Most Customer Code (CC) ECRs occurred after Grenada was approved for production, including 54 electrical ECRs.
 - f. One third of electrical ECRs occurred after Grenada was released to production.
 - g. Almost two thirds of mechanical ECRs occurred *after* Grenada was released to production. This represented 283 changes.
- 130. These are significant because mature and stable products, tend to have very few changes post-release, and the changes that are made are typically permanent. Thus, a large number of post-release changes is indicative of an unstable product, and a large number of temporary changes is indicative of quick fixes that are made to keep the production line running. For the ST3000DM001, the number of post-release changes were staggering, and a substantial percentage of them were designated as temporary.
 - 131. The following graph shows ECR data plotted by month.

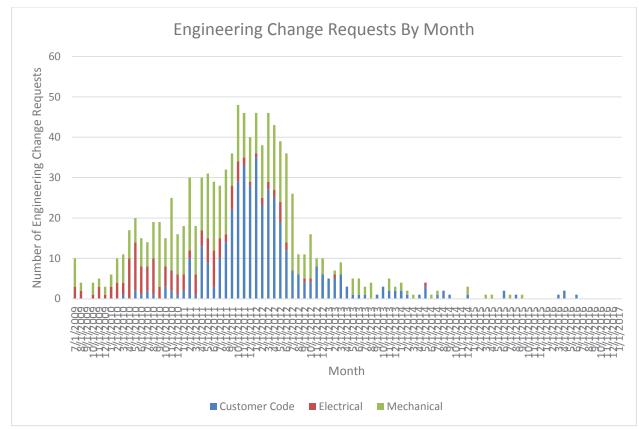


Figure 19: Graph of Grenada Classic ECR by month

132. The X axis is difficult to read in Figure 19 and the graph in Figure 20 below expands the first few years ECRs. The yellow highlighting at 5/1/2011 shows approximately when Grenada Classic was released into mass production.

- 133. The above graph shows that in the year following the initial release of the Drive, at least 30 ECRs were raised every month, and for much of that time there were more than 40 ECRs raised each month. This means that on average, an ECR was raised every single day for a year.
- 134. Although not all ECRs are related to reliability, the evidence supports my opinion that Seagate's reliability testing and quality control mechanisms were deeply flawed, which resulted in a highly unstable product that was shipped prematurely. I address the specifics of some of the ECRs below.

12

13

15

14

16

17

18

20

19

2122

23

24

25

2627

28

⁵⁵ FED_SEAG0027241.

135. Chris Labbe, Senior Director of Analysis and Solutions Engineering, wrote the following email in October 2012 stating "Grenada is not very stable right now." (emphasis mine).

From: Chris G Labbe <chris.g.labbe@seagate.com>

Date: Sun, Oct 21, 2012 at 9:13 PM

Subject: Re: Agenda for QIR Executive Reviews, Oct 30-31 To: Andrei Khurshudov sangle-com/

Here's our daily report on the 90 day inventory of failures by source.

Mostly, the operation of concern is CST2, which indicates the QA version of GIO, usually run as LODT.

In the recent history, Grenada is the highest volume by far. But Grenada is not very stable right now. It could be a good study since it would represent the extreme ... could we still catch the existing problems even with nearly constant shifts in performance.

Otherwise, Pharaoh is the other candidate. More mature and stable. If sampling doesn't reveal the same answer here, then it might not on any other program:)

Figure 21: FED_SEAG00006442 (highlight added)

136. The Grenada BP also had an unusually high number of ECRs. The Grenada BP had 732 ECRs, of which 13 were "Emergency," 19 were "Critical," and 696 were designated as "serious." A mere 3 ECRs were designated as "Minor." In my experience, this means that the problems with the Drive continued, and it was still an immature and unstable product.

a. Electrical ECRs

137. The following examples of electrical ECRs applicable to Grenada Classic provide an understanding of the stability of the electrical design. The sheer number of issues is not the sign of a mature product design that is ready for mass production.

138. ECR0133245 was raised on March 8, 2011, about 6 weeks before the ST3000DM001's first shipping approval. This ECR, which was designated as "Serious priority" and "Improvement- Design Engineering," pertained to burnt switching regulators that control power on the Drive. Shortly before the Drive was to be put into production, Seagate discovered that it had made a significant design mistake around a switching regulator which could result in the regulator

DECL. OF ANDREW HOSPODOR ISO CLASS CERT. - 42 CONTAINS MATERIAL DESIGNATED AS HIGHLY CONFIDENTIAL Case No.: 3:16-CV-00523 010581-11 997236 V1

being burnt. Switching regulator circuits are not trivial to design, so a blunder of this magnitude at this stage of development is remarkable.

- 139. On May 10, 2011, two weeks *after* the ST3000DM001 was first released to production, ECR0135418 was raised and designated as "Critical Priority" and "Improvement-Design Engineering." It pertained to a step-down regulator, which is used to convert a higher input voltage (such as 5V) down to a lower output voltage (such as 3V). With these types of devices, the output voltage is set via the use of a resistor divider network.
- 140. This ECR was raised to change the value of the resistors that make up the feedback network. It is unclear from the ECR description whether Seagate changed the output voltage (which would be enormously significant) or integrated an alternate part that needed a slight tweak to the resistors. Regardless, it is quite remarkable that a change of this type would be made two weeks after the product was released into mass production because such a change is normally processed months before a product is released to manufacturing.
- 141. Two days after the above ECR, ECR0135564 was raised. It was given a "Serious Priority" and was classified as "Improvement Manufacturing Process." This ECR concerns the reduction of solder height on the bare printed circuit boards used in the ST3000DM001.
- 142. It is not particularly clear from the ECR, but the way in which solder height would be reduced is via changes to the solder stencil aperture, which is a manufacturing device that controls the application of solder paste. It is critical that the correct amount of solder paste is applied to the printed circuit board, as too much or too little will lead to poor connections. Thus, the correct design and sizing of the solder stencil aperture is a critical step in ensuring a high quality printed circuit board assembly. Again, it is remarkable that within a couple of weeks of the ST3000DM001 being approved for shipment, Seagate needed to change such an important part of the printed circuit board manufacturing process. Problems of this type are normally ironed out as part of a pre-production phase.
- 143. The above examples demonstrate that the electrical design was still in a state of flux when the ST3000DM001 went into mass production and was approved for shipment.

b. Mechanical ECRs

- 144. Following are examples of the mechanical ECRs raised Grenada Classic.
- 145. On August 3, 2011, ECR0138496 was raised to allow for "Initial Release & Structure of NHK 4.5 HSAs." The HSA is the Head Stack Assembly that contains the recording heads, positioning arm, and servo motor windings. A picture of a typical HSA is shown below:



Figure 22: An example of a Head Stack Assembly. 56

- 146. The HSA is a major component of a HDD, so it was unusual to see a new HSA design being introduced to the Grenada product line only four months into mass production. In fact, the HSA must be a stable to mass produce reliable hard drives. Redesigning the HSA after the first quarter of production suggests the Drive was not ready for production with its original HSA. Many of the other mechanical ECRs are also related to either the HSA or HDA (Head Disk Assembly) areas.
- 147. Another major mechanical issue concerned tolerance issues with the Disk Separator Plate ("DSP"). On May 31, 2012, there was a "hold" related to the DSP. A hold is put into place when a defect is discovered or a hard drive or hard drive component otherwise exceeds the manufacturer's "trigger limits" for AFR, MTBF, defective parts per million, or some other reliability metric. A hold can be a shipping hold, which is a freeze on the shipment of the hard drive from one

⁵⁶ See MjM Data Recovery Ltd., Head Stack Assembly, https://www.mjm.co.uk/hard-disk-disassembly/hard-disk-head-stack.html (last accessed October 9, 2017).

or more factories, or a build hold (sometimes referred to as a "stop build"), which is a freeze on building the hard drive with a specific part.

148. The DSP hold was put in place due to a mechanical mismatch between the DSP and a component called the motor base assembly ("MBA"), such that the DSP became warped after putting in the DSP screw. A diagram of the DSP and MBA is below.

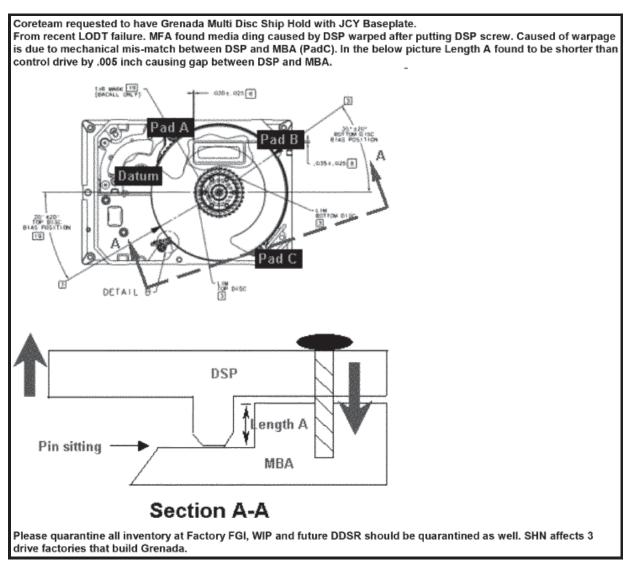


Figure 23: Details on DSP Tolerance Problem. FED_SEAG0008927, at 8928

149. The DSP at issue had been in use since 2010 and was used in the ST3000DM001's early development phases.⁵⁷ It was also used in two drives that preceded the release of the ST3000DM001, which were codenamed "Trinidad" and "Bogart." The fact that it took Seagate two

DECL. OF ANDREW HOSPODOR ISO CLASS CERT. - 45 CONTAINS MATERIAL DESIGNATED AS HIGHLY CONFIDENTIAL

Case No.: 3:16-CV-00523 010581-11 997236 V1

⁵⁷ Grenada BP ECQ Approved Final 6-5-12, FED_SEAG0026751, at 26781.

years to discover the problem is remarkal	ole, especially cons	sidering the DSP wa	as used in multiple
hard drives.			

- 150. In response to the problem, on June 1, 2012, ECR0148346 was raised as "Serious priority", "Improvement Design Engineering" and "Permanent." This ECR called for the use of reworking / modification of existing parts, followed by a switch to a new part to eliminate the mechanical mismatch between the DSP and the MBA.⁵⁸
- 151. However, this was not the end of this saga. On June 25, 2012, ECR 0149074 was raised. This ECR stated:

ECR0148346 [the ECR discussed immediately above] was pushed through as urgent with the understanding that PN 100694007 was only a few days away from being fully qualified. It's been several weeks and the part is still not qualified, thus it is being removed from the BOMs and ECR0148346 is being backed-out!⁵⁹

- 152. Generally, a part becomes "qualified" when testing demonstrates that it meets the applicable requirements imposed by the hard drive manufacturer. Here, a non-qualified part was rushed through as urgent to address the DSP issue on the understanding that it would be qualified within a few days. Twenty-four days later (and thus presumably after 24 days of the Drive being shipped with a non-qualified part), this ECR was raised to stop the Drive from being built with the unqualified part.
- 153. However, even this was not the end of the situation because a few weeks later, on July
 12, 2012, Temporary DA ECR0149636 was generated. This ECR stated, in part:
 ECR0149636, Grenada: TEMP DA allow ship 26K drives w/DSP PN
 100694007 to Disty . . . Allow ship of 26K drives with DSP PN
 100694007 to Disty only 60
- 154. Thus, this ECR was asking for permission to ship 26,000 Disk Drives with the same (presumably still unqualified) part to "disty" customers. This ECR was approved. In essence, "disty"

⁵⁸ FED_SEAG0027240 at row 923.

⁵⁹ This same part number turns up again in ECR0150131 (July 27, 2012). In fact, this one part was the topic of no less than seven ECRs spread over the dates December 2011 to July 2012. See FED SEAG0027240 rows 848, 919, 923, 941, 957, 962 and 982.

⁶⁰ FED_SEAG0027240 at row 957

5

7

9

1011

12

1314

15

16

17

18 19

20

2122

23

24

2526

2728

was used as a dumping ground for Drives with unqualified parts. As explained below, this is not the only example of Seagate shipping Drives to "disty" or SBS customers that it deems unfit for shipment to OEMs.

155. Although mechanical tolerance analysis used to be a difficult and challenging task, today, and at the time the ST3000DM001 was being produced, modern computer tools, such as computer-assisted design software, make it an almost trivial task. The fact that it took two years for Seagate to discover the DSP tolerance issue suggests that a mechanical tolerance analysis was not performed, was performed carelessly, or the results were ignored. It further demonstrates the ineffectiveness of Seagate's reliability testing and quality control processes, and underscores Seagate's willingness to rush hard drives and hard drive components into production.

c. A Plethora of Firmware Versions Were Released

156. Firmware is software that controls the basic functions and operations of a device. In the context of hard drives, the firmware executes requests to read or write user data, performs diagnostics and manages defects. For some products, the firmware is permanent and cannot be changed. For others, like hard drives, firmware can be updated. When Seagate released an updated firmware version for the ST3000DM001, it would be programed into Drives that during the manufacturing process. Seagate would also make the firmware update available for download by ST3000DM001 consumers.⁶¹

157. The ST3000DM001 underwent at least 12 firmware updates as shown in FED_SEAG0018735, a spreadsheet that lists Seagate's firmware releases. The last update referenced on this spreadsheet was from March 2015 and, as such, I do not know whether any subsequent firmware versions were released.

158. For a high-volume product that had supposedly gone through a plethora of pre-release qualifying tests, this is an extraordinarily high number of versions, and strongly suggests that either

⁶¹ See Seagate, Barracuda (1TB/disk platform) Firmware Update, http://knowledge.seagate.com/articles/en_US/FAQ/223651en (last accessed Oct. 9, 2017).

12

11

13

1415

16

17

18

1920

2122

23

24

25

2627

28

the firmware was unstable, or the firmware was being called upon to solve other problems in hardware, or both.

- 159. For example, according to an internal Seagate email, the ST3000DM001 suffered from a "firmware bug that affected reliability" by putting it in a Drive Not Ready (DNR) state. 62 The bug was purportedly fixed in April 2012.
- 160. Seagate's support page devoted to firmware updates includes the following statement:⁶³

Like any software, firmware is improved over time and problems are also fixed. Many drive families have a couple of firmware releases during the life of the product. [Emphasis added]

- 161. The statement that many drive families have a couple of firmware releases during the life of the product comports with my experience of high volume products whereby there will be an initial firmware release and then perhaps one or two more during the life of the product.⁶⁴
- 162. However, as discussed above, the ST3000DM001 went through at least twelve firmware versions during its product life, which supports the hypothesis that ST3000DM001 was an abnormally unstable product. The abnormality is further evidenced by the reaction of Glen Almgren, Seagate's Reliability Engineering Director, during his deposition in which he stated it would surprise him to learn that the Drive had 10 or more post-production firmware releases.⁶⁵
- 163. The documents embedded in the spreadsheet listing firmware releases provide an understanding of the Drive's various firmware problems. Note that because these documents were embedded, they are not separately Bates stamped.
- 164. The first embedded document pertains to a firmware update that was released on January 11, 2012. The problem addressed by the update was that Seagate firmware engineers

⁶² FED_SEAG0009894, at 9895.

⁶³ Seagate, *Firmware Updates for Seagate Products*, http://knowledge.seagate.com/articles/en_US/FAQ/207931en (last accessed Oct. 9, 2017).

⁶⁴ The support page also states, "Please note that Seagate does not offer details about specific firmware." This level of concealment is unusual as most companies (including Western Digital) provide information concerning firmware updates.

⁶⁵ See Almgren Dep. 61:5-62:5.

neglected to set a debug serial port on the hard drive to a fixed state. This made the hard drive susceptible to erroneously executing commands that it perceived to be valid but were just electrical noise on the debug serial port. The effects of this could be serious — it could result in the Drive going to a Drive Not Ready (DNR) state. This means the drive would appear as being 'not ready' — and thus would not be accessible.

165. The solution to the problem was trivial — Seagate engineers simply had to set a bit in a control register on the disk drive to fix the diagnostic port into a fixed state, rather than allow it to float in an unstable manner.

- 166. The consequences of failing to set a debug serial port to a fixed state are well known in the hard drive industry, and in my opinion, Seagate had at least four opportunities to prevent or detect this problem pre-release: At the schematic review stage, at the debug serial port protocol design stage, at the firmware code review stage, and at the testing stage. The fact that such a potentially serious problem with such a simple fix was not addressed until months after the ST3000DM001 had been released into mass production supports the notion that the Drive was not adequately tested prior to shipment to end users.
- 167. By way of further example, there was yet another firmware update on April 23, 2012, approximately three months after the first update.
- 168. This firmware update was intended to, among other things, address a "race condition" and "erroneous drive cache hits." A race condition is normally a serious defect that could result in the drive malfunctioning. An erroneous drive cache hit is also a serious error and could result in incorrect data being provided to the user. The fact that these problems were not addressed until a year after the Drive was first released further indicates that the ST3000DM001 was not adequately tested prior to shipment.

2

8

9

11

12

1314

15

1617

18

19

2021

22

23

24

25

2627

2728

169. Given the instability of the ST3000DM001, it is not surprising that the Drive was subject to repeated shipping holds. The numerous ship hold documents produced by Seagate during discovery show the extent of the reliability problems with the Drive.⁶⁶

170. The Drive was subject to at least 13 ship holds between June 2011 and August 2012 alone. This number of ship holds in such a short amount of time is staggering. In my experience, a ship hold every month on average for over a year indicates a product with ongoing problems.

171. At least four of the ship holds involved head-related failures,⁶⁷ and these ship holds affected a massive number of drives. For example, a ship hold order put in place on February 4, 2012 affected 320,025 Drives that had already been shipped from one of Seagate's factories in Korat, Thailand.⁶⁸

172. In addition, a March 15, 2012 ship hold affected approximately 85,000 shipped drives.⁶⁹ Of particular importance is that this ship hold only applied to OEM Drives, and the factory was instructed to "Downgrade failed drives to Disty and SBS."⁷⁰ In other words, Seagate shipped failed OEM Drives to hard drive retailers and resellers, who in turn sold them to consumers.

173. Furthermore, some of the ship holds describe contamination issues. An internal Seagate email sent on July 12, 2012 stated that "Grenada triggers are mainly due to head instability and particle related issues." The term "particle related issues" is a euphemism for contamination. The email continues:

We identified head instability issue with the first SSO [Stop Ship Order] in dec/jan. As a company we made a decision to use the

 ⁶⁶ E.g. FED_SEAG0006184; FED_SEAG0008927; FED_SEAG0016862; FED_SEAG0054864;
 FED_SEAG0054917; FED_SEAG0054972; FED_SEAG0054997; FED_SEAG0055000;
 FED_SEAG0055022; FED_SEAG0055026; FED_SEAG0055041; FED_SEAG0055073;
 FED_SEAG0055087; FED_SEAG0055139; FED_SEAG0055154.

⁶⁷ See FED SEAG0054997; FED SEAG0055041; FED SEAG0055073; FED SEAG0055087.

⁶⁸ FED_SEAG0054972, at 54974.

⁶⁹ FED_SEAG0055041, at 55044.

⁷⁰ FED_SEAG0055041, at 55044.

⁷¹ FED_SEAG0060976.

'bad' wafer/slider material to meet Q3/Q4 volumes. We expected to finish using this material in middle of Q4, however we will continue to consume until WW17 (via disty/SBS config). To improve OEM performance we are using non-SLT-05 for OEMs...To further improve OEM performance we have tighter OEM cert specs. I suspect this is another reason why OEM performance in ORT is improving but Disty is not (even with non-SLT05 material).

174. This passage is extremely important for two reasons. First, it further demonstrates Seagate's willingness to dump bad Drives into the "disty" and SBS channels, and it makes it clear that Seagate did so to meet production volumes. Second, it shows that Seagate prioritized the OEM channel such that it was willing to tighten OEM certification specifications when problems arose but did not do the same for the other channels, resulting in a deleterious impact on the reliability of the Drives shipped to SBS and distribution consumers.

175. There are additional examples of bad Drives being sent to the distribution and SBS channels. On at least one occasion, an OEM customer placed a ship hold on the ST3000DM001 because of the defect rates found in production. Despite this, Seagate continued to ship Drives to the other channels the include the consumer making up this class. This is summarized in Figure 24, below, which shows that in May 2012,

Despite this, there is no indication that Seagate halted shipment to the other channels. In effect, Seagate lowered their inventory and kept production levels high by redirecting drives refused by their OEMs into the SBS and "disty" channels bound for consumers making up this class.

Without high production levels, Seagate would certainly be at a disadvantage to its major competitor, Western Digital.

⁷² *Id*.

e. Reliability Problems Escalated Rapidly after Release of the ST3000DM001

176. The ship holds, as well as other documents produced by Seagate during discovery,
ndicate that the ST3000DM001 was unreliable, unstable, and defective, and that problems with the
Drive began to manifest shortly after its release and escalated in early 2012. The figures below are
from February 2012. Note that the dates shown in the charts (e.g. 1218) refer to week 18 in financial
year 2012. Figure 25 shows that Grenada's projected AFR was 2.21% and that its failure percentages
were constantly above the warning levels. The main factors driving the elevated failure rate included
'degraded heads," "head instability," and "NMD" (new media defect) caused by contamination. Disk
drive heads are very sensitive devices that fly over the disk media so closely that a human hair would
cause them to crash. Heads degrade when subject to abrasion from contacting the disk, sometimes
damaging the media as well. A head that collects contaminants or excessive lubricant on its air
bearing surface will fly higher and generate more heat due to increased friction. The combination of
ncreased flying height and increased Johnson noise, proportional to temperature, leads to new
defects when writing data and reading back from the disk. In the worst case, the areas of the disk
with heavy contaminants may trigger new media defects that are added to the defect list after the disk
eaves the manufacturing facility.

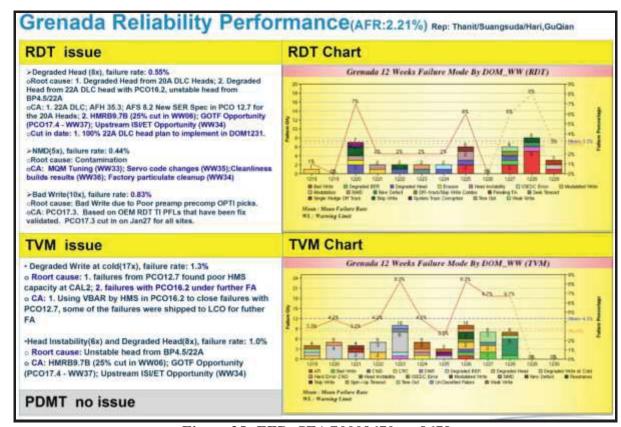


Figure 25: FED SEAG0009670, at 9678

177. Figure 26, below, shows in dramatic fashion that not only were the problems bad – but they were getting steadily worse. The green line at 0.5% represents Seagate's target. The orange line at 1% AFR is marked as "UCL" or Upper Control Limit. It can be seen that the actual projected AFR based on ORT (Ongoing Reliability Testing) is above 1% for 12 weeks straight and is rapidly increasing at the end of the period.

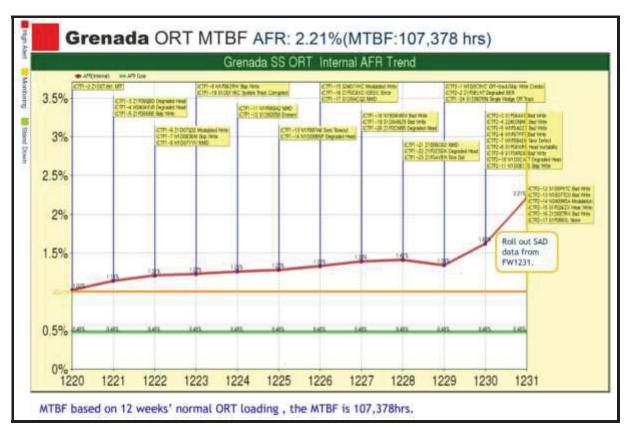


Figure 26: FED_SEAG0009670, at 9681

178. Figure 27, below, provides an analysis using RDT (Reliability Demonstration Testing). It extends a few weeks more into 2012 work week 34 and shows that work week 33 was the worst week yet.



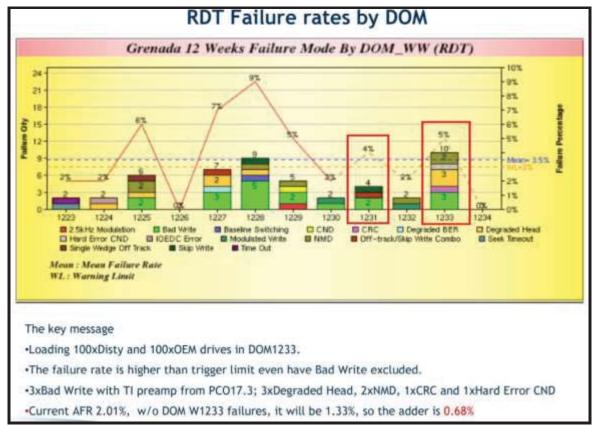


Figure 27: FED_SEAG0009576, at 9580

179. As set forth in Section G above, on June 4, 2012, ORT revealed that Grenada Classic exhibited a 3.436% AFR that is not <1%.

Grena	ada	ORT	FE Table			
G	renada Classi	c ORT	Updated	Updated: 6-4-12 12:00 AM		
AFR (1st year Wei	bull) 3,4	436% From a	I fails Veibull MLE	No_Info	QTY_TESTED	
MTBF (1st year Wei	bull) 68	645.4				
Minimum a	AFR: 0.0	021% From 2	ero fail Veibull @ 50% CL	2400	POHYear	
Total Number of Failu	ıres	81		0.506781	Weibull Beta	
AFR for 1 fai	ilure 0.0	042% AFRIde	crease per failure @ 100% fix effectiveness	535	Average Test Hours	

Figure 28: Grenada Classic ORT raw AFR was 3.436% on 6/4/2012 (FED_SEAG0026751, at 26785)

180. Even with the contemplated fix effectiveness calculated, the projected AFR was reduced to only 2.35%, and still not <1% as shown by Figure 29, below.

Modes March Marc
Total Number of Falls 81 Reduced AFR: 2.39% 1.79%
Company MEDI - 400V 400V
Figure 29: Grenada Classic ORT Reduced AFR was 2.35% on 6/4/2012.
Figure 29: Grenada Classic ORT Reduced AFR was 2.35% on 6/4/2012. (FED_SEAG0026751, at 26786) f. Internal Seagate Documents Explicitly Acknowledge that the ST3000DM001 was Unstable, Unreliable, and Defective
(FED_SEAG0026751, at 26786) f. Internal Seagate Documents Explicitly Acknowledge that the
Corresponding MTBE; 100K 132K



The Yearly Return Rate ("YRR," also referred to as "Annual Return Rate," or 185. "ARR") represents all of the drives returned to Seagate for any reason. Hard drive manufacturers, including Seagate, analyze returned drives and categorize them. For example, a large percentage will

15

16

17

18

19

20

21

22

23

24

25

26

27

⁷³ FED_SEAG0057214, at 57215.

⁷⁴ FED_SEAG0002673, 2674.

be accepted as genuine failures, others will be classified as failed due to abuse, while others will be classified as No Trouble Found (NTF), meaning the drive appears to be working perfectly. It is worth noting that drives that experience transient problems (such as the DNR problem caused by a firmware error described in Section iii, above) would be classified as NTF by Seagate unless the transient problem with the floating serial debug port appeared during their failure analysis.

The YRR is a reliability metric in that a high YRR is indicative of an unreliable, 186. unstable hard drive.

8

9

10

11

12

13

14

15

16

17

18

19

1

2

3

4

5

6

7

At this time, a root cause of the high return rate was contamination that occurred 187. during the manufacturing process. 75 Specifically, the contamination was "PFPE smear on media and contamination on ABS."76 "PFPE" stands for PerFluoroPolyEther, which is a type of lubricant and "ABS" stands for air bearing surface – that section of the head closest to the platter that is shaped to allow the head to fly over the platter at a prescribed flying height. PFPE is a common lubricant in the disk drive industry. When used properly, it forms an even coating across the disk. However, contaminants in the PFPE cause small mounds to form that strike the air bearing surface and can result in PFPE being smearing in a non-uniform way across the disk. In the worst case, some areas of the disk are left without lubricant and become defective, while others have some much piled up the head cannot fly over them safely.

The Apple recall was announced on June 19, 2015, but the announcement did not

188.

189.

20

21

22

23 contain any reference to Seagate.⁷⁸ 24

25

⁷⁵ FED SEAG0057214, at 57215; FED SEAG0057123, 57127.

26

⁷⁶ FED SEAG0057214, at 57215.

27

28

⁷⁷ See FED_SEAG0057214, at 57215.

⁷⁸ FED SEAG0002673, 2675.

190. In addition to the 130,000 affected OEM Drives sold to Apple, Seagate projected that there were "850K [non-OEM] drives still in warranty that may be returned due to contamination issue."⁷⁹

191. The severity of this issue is best illustrated by the fact that, internally, Seagate considered offering free data recovery to customers who called and complained about affected ST3000DM001 Drives that had failed, at a projected cost of \$26.8 to \$148.9 million. Figure 30 below is a chart produced by Seagate during the course of discovery.

	PRELIM W	orst-	Case Scenario		
	Apple Recall		Channel		TOTAL
Affected Quantity	135,000		850,000		985,000
Expected Returns (including 100% of all products)	135,000		850,000		985,000
Costs:					
Cloud Backup Services For 1 Year @ \$2/month for 200GB	\$ 3,240,000		N/A	\$	3,240,000
Data Recovery @ \$340/drive (including 50% of channel customers)	N/A	\$	144,500,000	\$	144,500,000
Solutions Center cost for add'l temp HC over 6 months @ ~\$5/drive		Ś	4,444,444	Ś	4,444,444
TOTAL COST	\$ 3,240,000	\$	148,944,444	\$	152,184,444
			Contamination" Issu on Moose epidemic	-	•
	Apple Recall		Channel		TOTAL
Affected Quantity	135,000		850,000		985,000
Expected Returns (including 50% of Apple					
customers and 18% of product from channel)	67,500		153,000		220,500
Costs:					
Costs: Cloud Backup Services For 1 Year @ \$2/month for 200GB	\$ 1,620,000		N/A	\$	1,620,000
Cloud Backup Services For 1 Year @ \$2/month for	\$ 1,620,000		N/A	\$	1,620,000
Cloud Backup Services For 1 Year @ \$2/month for 200GB	\$ 1,620,000	\$	N/A 26,010,000	\$	
Cloud Backup Services For 1 Year @ \$2/month for 200GB Data Recovery @ \$340/drive (including 50% of	\$ 1,620,000	\$	•		
Cloud Backup Services For 1 Year @ \$2/month for 200GB Data Recovery @ \$340/drive (including 50% of channel customers would request data recovery)	\$ 1,620,000	\$	•		1,620,000 26,010,000 800,000

Figure 30: Seagate's Internal Analysis of Projected Cost Associated with the Contamination Defect (FED_SEAG0055783)

192. Despite the severity and massive scale of the problem, Seagate never followed through on its plan to offer free data recovery to consumers, nor did it issue any sort of consumer

⁷⁹ FED_SEAG0055784, at 55785.

⁸⁰ Clark Dep., at 136:1-13.

product recall.⁸¹ In fact, there is no indication that Seagate ever informed consumers that there was a contamination problem with the Drive. 82 Seagate has not issued a product recall since at least 2001.

- 193. There are numerous other internal Seagate documents and emails which explicitly evidence that Seagate knew the Drive was riddled with issues. Indeed, as early as October 10, 2012, Seagate was aware that the Grenada was plagued with "NHK particulate contamination" and "head instability" issues.83
- 194. In summary, internal Seagate documents, including those pertaining to the Apple recall, show that the ST3000DM001 was unstable, defective, and suffered from contamination issues on a massive scale. They further demonstrate that Seagate was aware of these issues and concealed them from Apple, retailers, and end-users. Contamination-related issues and failures, as well as headrelated failures, were also the subject of multiple ship holds and documents pertaining to the degrading reliability of the Drive, and Seagate "addressed" the problem by dumping bad OEM Drives into the SBS and distribution channels. These same Drives were ultimately sold to consumers.
- 195. The instability, unreliability, and defective nature of the Drive is further exemplified by the Drive's extremely low factory yield; the large number of engineering changes made to the Drive, particularly post-release; the high percentage of engineering changes that were temporary,

DECL. OF ANDREW HOSPODOR ISO CLASS CERT. - 59 CONTAINS MATERIAL DESIGNATED AS HIGHLY CONFIDENTIAL Case No.: 3:16-CV-00523 010581-11 997236 V1

2

1

3 4

5

6

7 8

9

10

11

12 13

14

15

16

17

18

19

20 21

22

23

24

25

26

⁸¹ Clark Dep., at 89:10-15, 120:12-121:12.

⁸² Seagate has seen high return rates on the Drive in other instances. For example, an internal Seagate document dated July 25, 2014 states that the Field Annual Return Rate for the BackUp Plus Desk was 9.14%. See FED SEAG0026135, at 26138. Likewise, it states that the Field ARRs for the Expansion Plus and the Expansion Plus Desk were 7.63% and 12.15%, respectively. See id. at 26139. Seagate never issued a recall for these Drives. In fact, since at least 2001, Seagate has not issued a recall for any hard drive. See Clark Dep. at 89:10-15.

⁸³ FED SEAG0056259, at 56296 ("DSP tolerance to MBA" is also listed, which is also addressed in this report). In a January 26, 2015 email, Dave Rollings, Field Applications Engineer, enumerated a multitude of problems with Grenada. Specifically, he stated that the Drives manufactured in 2012 had a "2x field return rate" due to "a multitude of issues" related to particle contamination, air bearing design problems, and other issues that needed to be fixed with subsequent firmware releases. FED SEAG0009883, at 9885.

In a May 20, 2015 email, Joni Clark, Global NAS Segment Manager, stated that the Backblaze reports were "not baseless" and that the ST3000DM001 drives "did have contamination issues that caused them to fail much faster and more." FED SEAG0006071, at 6072.

indicating that Seagate was attempting to devise quick fixes for the Drive; the staggering number of ship holds put in place; and the abnormally high number of firmware revisions.

196. The foregoing also demonstrates that Seagate's reliability testing and quality control processes were inadequate and flawed and that the Drive was released before it was ready for production. This is further exemplified by the fact that Seagate made at least one significant design change and at least one substantial manufacturing process change mere weeks before the Drive was released; engineering changes were made to the Drive post-release that should have been done pre-release. Furthermore, Seagate redesigned a major Drive component a mere four months after the Drive's release; and Seagate failed to detect a major problem with the Drive's disk separator plate for two years.

J. Given Its Knowledge that the Drive Was Unstable and Unreliable, Seagate Gradually Changed the Specifications

197. Seagate has made significant changes to various specified parameters between 2011 and 2017. The table below summarizes some of the more significant changes taken from various versions of the ST3000DM001 Product Manual.

	$Rev A2^{84}$	<i>Rev G</i> ⁸⁵	<i>Rev P</i> ⁸⁶	<i>Rev. V</i> ⁸⁷
Max ambient temperature (°C)	70	60	60	NS ⁸⁸
Maximum case temperature (°C)	69	69	69	60
Maximum operating wet bulb temperature (°C)	37.7	37.7	37.7	26
Maximum non-	40	40	40	29

⁸⁴ FED SEAG0019045. Dated April 2011.

⁸⁵ FED SEAG0030657. Dated October 2012.

⁸⁶ FED_SEAG0003639. Dated September 2015

⁸⁷ Dated September 2016. This is the latest version of the manual available on Seagate's website at http://www.seagate.com/www-content/product-content/barracuda-fam/desktop-hdd/barracuda-7200-14/en-us/docs/100686584v.pdf

⁸⁸ NS = Not Specified

1
2
3
4
5
6
7
8
9
10
11

	<i>Rev</i> <i>A2</i> ⁸⁴	<i>Rev G</i> ⁸⁵	<i>Rev P</i> ⁸⁶	<i>Rev. V</i> ⁸⁷
operating wet bulb temperature (°C)				
AFR (%)	0.34	NS	<1.0	< 1.0
Workload (TB / year)	NS	< 55	< 55	< 55
Power On Hours	2400	8760	2400	2400
Storage (original unopened package) max days	NS	NS	NS	180
Storage unpackaged max days	NS	NS	90 at wet bulb of 32°C	60 at wet bulb of 26°C

Figure 31: Change in specification of ST3000DM001

198. Figure 31 shows some key ST3000DM001 specifications taken from the Product Manual dated April 2011, October 2012, September 2015 and finally September 2016. Text highlighted in red shows a parameter that was made more restrictive when compared to the column to the left. Green indicates a specification that was made more permissive. It may be seen that over the span of 5.5 years Seagate has successively derated their specification and made the operating envelope more restrictive. From a reliability perspective the key changes are discussed below:

1. Maximum Case Temperature

199. Seagate reduced the maximum case temperature from 69°C to 60°C. This is a very large reduction and is particularly notable in that as recently as September 2015 (i.e. four and a half years after the product was released), the maximum allowed case temperature was specified at 69°C. The fact that Seagate saw fit to reduce this temperature by 9°C strongly suggests that the previous value of 69°C was having a deleterious impact on system reliability. To understand how onerous this restriction is, it is important to understand how much hotter the ST3000DM001's case is than the ambient temperature. Testing performed in 2011 showed that the ST3000DM001 case temperature was 38°C above ambient, where the ambient temperature was 40°C and the HDD temperature

stabilized at 78° C. ⁸⁹ If this data is still valid, then this implies that with a maximum allowed case temperature of 60° C, the actual ambient temperature around the disk drive should not exceed 60° C - 38° C = 22° C (i.e. 72° F). Given that it is inevitably warmer inside a computer than inside a room (5°C would be a conservative estimate), it suggests that the maximum room temperature in which an ST3000DM001 should be used is $60 - 38 - 5 = 17^{\circ}$ C (63° F). This is a remarkably low temperature. Any customer running an ST3000DM001 in a room hotter than 17° C would thus expect to see an increased AFR.

2. Maximum Operating Wet Bulb Temperature

200. The maximum operating wet bulb temperature has been reduced from 37.7°C to 26°C. This is a very large reduction and is particularly notable in that as recently as September 2015 (i.e. four and a half years after the product was released), the maximum allowed operating wet bulb temperature was 37.7°C. The fact that Seagate saw fit to reduce this temperature by 11.7°C strongly suggests that the previous value of 37.7°C was having a deleterious impact on system reliability. To understand how onerous this restriction is, an ambient temperature of 83°F at a relative humidity of 75% would be at the wet bulb temperature limit of 78.8°F or 26°C. To put this in perspective, at the time of writing this report, it is 81°F and 84% relative humidity in Houston, Texas. This has a wet bulb temperature higher than permitted by Seagate's latest specification.

3. Unpackaged Storage Specification

2011 and 2012 there were no restrictions specified. By 2015 the drive could be stored for 90 days provided the environmental specifications including a 32°C wet bulb limit was met. Finally, in 2016, the storage specification was reduced to 60 days provided the environmental specification including a 26°C wet bulb limit was met. Again, drives shipped to retail outlets in Houston, such as BestBuy or Costco, could remain in a warehouse for 60 days and be exposed to temperature and humidity outside of Seagates derated specifications, before being purchased by an unknowing consumer.

Case No.: 3:16-CV-00523 010581-11 997236 V1

⁸⁹ See FED SEAG0009095 at 9100, 9102.

4. Workload Rating

202. By Revision G (October 2012) a revised rated workload statement had been added to the user manual, which stated:

Average rate of <55TB/year. The MTBF specification for the drive assumes the I/O workload does not exceed the average annualized workload rate limit of 55TB/year. Workloads exceeding the annualized rate may degrade the drive MTBF and impact product reliability. The average annualized workload rate limit is in units of TB per year, or TB per 8760 power-on hours. Workload rate limit= TB transferred x (8760/recorded power-on hours).

- 203. The statement is a masterpiece in obfuscation. In fact, Seagate acknowledged in an internal document that "Seagate does a poor job in defining the product usage conditions and AFR transfer functions (guidelines) in our product manual compared to Hitachi." ⁹¹
- 204. Nonetheless, I interpreted the above language to mean that a user should not exceed 55TB in a year, where a year is 8760 POHs. There is nothing in this statement (or any other statement in the manual) to suggest that the AFR specification is based on 2400 POH. Indeed, the number 2400 does not appear in the Rev. G manual, nor does any actual statement of what constitutes the specified MTBF or AFR.
- 205. This is significant, because, higher workload stress has an impact on hard drive reliability. Indeed, Dr. Khurshudov, in the June 1, 2012 version of his report, concluded, "There seems to be a good correlation between the amount of workload stress and the product propensity to show constant failure rate or wearout." I agree with Dr. Khurshudov on this point because it is consistent with his opinion that the Weibull β values should be changed to reflect constant failure or wearout.
- 206. A drive that is powered down has no stress, and Seagate is now defining a workload of 55TB/year, which is less than 2MB/second of user data transfer. For comparison, the Seagate

⁹⁰ FED_SEAG0030657, at 30668. The same, or a substantially similar, statement remained in various iterations of the Product Manual until January 2015, when the POH rating was downgraded to 2400.

⁹¹ FED_SEAG0056341, at 56346.

⁹² FED_SEAG0001986, at 1993.

ST3000DM001 drives support the SATA 6Gbit/second transfer rate, which is capable of transferring 94MB/second. This nearly 50x derating of transfer workload, from 94MB/second to 2MB/second is unheard of in the data storage industry. I do note that most cell phone plans now limit the amount of data transferred per month, and cloud storage providers charge for monthly data transfers, but I have never heard of a limit placed on data transfers from a customer owned storage device.

K. Seagate Knew that the Drive Was Not Suitable for RAID

207. Seagate advertised the ST3000DM001 as being suitable for use in RAID, and the performance of the 7200 RPM Drive would be attractive for desktop RAID. However, unreliable drives are not suitable for use in RAID. As discussed throughout this report, the ST3000DM001 not only had a higher AFR than advertised, but it was also unstable for desktop RAID. The ST3000DM001 required numerous engineering changes and firmware updates to address a multitude of serious problems in the design and manufacture of the Drive.

208. A RAID is a collection of hard drives placed in an enclosure witha RAID controller that enhances reliability and availability of user data. There are different "levels" of RAID, including RAID-0, RAID-1, RAID-5, RAID-6, and RAID-10. All of these configurations provide data redundancy (except RAID-0, which is used for increasing storage space and improving performance). This means that the same data is written to multiple hard drives such that if one drive fails, the RAID can "rebuild" the data and preserved it. However, partial or total data loss can occur if another hard drive fails during the rebuilding process, which is often lengthy.

- 209. Accordingly, unreliable, unstable drives are not suitable for use in RAID because they substantially increase the probability of a failure occurring during a rebuild vis-à-vis more reliable, stable hard drives. Since Seagate knew that the ST3000DM001 was unreliable and unstable, it also knew that the Drives were not fit for use in RAID.
- 210. Moreover, RAID-1, which uses two hard drives that mirror data, and RAID-5, which uses three or more hard drives, are most common home RAID configurations. Seagate admitted in a

1

2

3

4

6 7

8

9 10

11 12

13

14 15

16

17

18 19

20

21 22

23

24

25

26

27

28

211. Other internal Seagate documents further show that Seagate knew that the ST3000DM001 was not suitable for RAID and that it should not have been advertised as such. For example, an internal Seagate email from January 2014 states that "the main issue here is that these guys are using Desktop drives in RAID systems . . . desktop drives like ST3000DM001 (Grenada) . . . are not designed for this type of environment."94 (Emphasis added). Another internal Seagate email from March 2016 states, "As a suggestion, if we do not want DT [desktop drives] to be used to [sic]

do not recommend for RAID environment."95 Other internal Seagate documents and emails also discuss how the ST3000DM001 should not be advertised as "perfect" for or otherwise suitable for RAID.96

a wrong environment, we should specify that the DT product is for 2400 application on the manual,

212. Seagate did not design the ST3000DM001 to be suitable for use in a RAID environment due to the Drive's instability and unreliability. Since Seagate was the entity that designed and tested the Drive, it by necessity knew, at the time of Drive release at the latest, that the ST3000DM001 was not suitable for use in RAID. Seagate went so far as informing a customer that the Drive was not suitable for RAID, but failed to inform consumers of such issues, or problems with contamination, or issue any recalls that may have prevented consumers in this class from losing their data.

V. SUPPLEMENTATION OF OPINIONS

I reserve the right to adjust or supplement my opinion after I have had the opportunity 213. to review other deposition testimony or in light of additional documents or other discovery that may be brought to my attention. I also reserve the right to adjust or supplement my analysis in light of

⁹³ FED SEAG0054829, at 54830.

⁹⁴ FED SEAG0006420.

⁹⁵ FED SEAG0021938, at 21939.

⁹⁶ See FED SEAG55589; FED SEAG0021998; FED SEAG0007293, at 7299.

any critiques of comments on my report and to offer additional opinions and evidence in reply to any opinions advanced by or on behalf of defendant Seagate.

I declare under penalty of perjury under the laws of the United States that the foregoing is true and correct. Executed this 07th day of November 2017, at Santa Cruz, California, USA.

Andrew Hospodor, Ph.D

Case 3:16-cv-00523-JCS Document 184-12 Filed 07/26/18 Page 71 of 100

APPENDIX 1

DECL. OF ANDREW HOSPODOR ISO CLASS CERT. - 67 CONTAINS MATERIAL DESIGNATED AS HIGHLY CONFIDENTIAL Case No.: 3:16-CV-00523 010581-11 997236 V1

1 MATERIALS RELIED UPON OR CONSIDERED 2 Pleadings, Discovery Responses, and Deposition Transcripts: In re: Seagate Technology LLC Litigation, Second Consolidated Amended Complaint. 3 In re: Seagate Technology LLC Litigation, Seagate Technology, LLC's Second Amended Response 4 to Interrogatory Nos. 9 and 10 of Plaintiffs' First Set of Interrogatories. 5 July 26, 2017 Deposition of Seagate 30(b)(6) Designee Glen Almgren. 6 September 7, 2017 Deposition of Seagate 30(b)(6) Designee Patrick Dewey. 7 September 8, 2017 Deposition of Andrei Khurshudov. 8 October 20, 2017 September 7, 2017 Deposition of Seagate 30(b)(6) Designee Alan Clark 9 10 Websites and Documents Obtained from the Internet: Seagate, Hard disk drive reliability and MTBF / AFR 11 http://knowledge.seagate.com/articles/en_US/FAQ/174791en?language=en_US&key=ka030000000t mWGAAY&kb=n&wwwlocale=en-us (last accessed October 10, 2017). 12 Seagate, Barracuda Desktop Hard Drives, 13 https://web.archive.org/web/20111129033926/http://www.seagate.com:80/www/en-14 us/products/desktops/barracuda hard drives#TabContentSpecifications (click on "Specifications" tab) (archived November 29, 2011). 15 Seagate, Barracuda Desktop Hard Drives, 16 https://web.archive.org/web/20111129033926/http://www.seagate.com:80/www/enus/products/desktops/barracuda hard drives (archived Nov. 29, 2011). 17 Seagate, Desktop Hard Drives, 18 https://web.archive.org/web/20120428124406/http://www.seagate.com:80/internal-hard-19 drives/desktop-hard-drives/ (archived April 28, 2012). 20 Seagate, Desktop Hard Drives, https://web.archive.org/web/20130117005718/http://www.seagate.com/internal-hard-drives/desktop-21 hard-drives/ (archived Jan. 17, 2013). 22 Seagate, Desktop Hard Drives, https://web.archive.org/web/20130911084603/http://www.seagate.com:80/internal-hard-23 drives/desktop-hard-drives/ (archived September 11, 2013). 24 Seagate, Desktop Hard Drives, 25 https://web.archive.org/web/20140124073650/http://www.seagate.com/internal-hard-drives/desktophard-drives/ (archived Jan. 24, 2014). 26 Seagate, July 2012 Storage Solutions Guide, available at https://www.seagate.com/files/www-27 content/product-content/ cross-product/en-us/docs/storage-solutions-guide-sg1351-11-1210us.pdf. 28

DECL. OF ANDREW HOSPODOR ISO CLASS CERT. - 68 CONTAINS MATERIAL DESIGNATED AS HIGHLY CONFIDENTIAL Case No.: 3:16-CV-00523 010581-11 997236 V1

1	Seagate, <i>October 2013 Storage Solutions Guide</i> , available at https://www.seagate.com/files/www.content/product-content/_cross-product/en-us/docs/storage-solution-guide-oct-13-ssg1351-14-1310us.pdf.		
2			
3	Seagate, <i>September 2016 Storage Solutions Guide</i> , available at http://www.seagate.com/www-content/product-content/barracuda-fam/desktop-hdd/barracuda-7200-14/en-us/docs/100686584v.pdf		
4	Seagate, Hard disk drive reliability and MTBF / AFR,		
5 6	http://knowledge.seagate.com/articles/en_US/FAQ/174791en?language=en_US&key=ka030000000t mWGAAY&kb=n&wwwlocale=en-us.		
7	Seagate, <i>Barracuda (1TB/disk platform) Firmware Update</i> , http://knowledge.seagate.com/articles/en_US/FAQ/223651en.		
8	Seagate, Firmware Updates for Seagate Products, http://knowledge.seagate.com/articles/en_US/FAQ/207931en.		
10 11	Western Digital, <i>How drive reliability is measured and the MTBF of WD drives</i> , https://support.wdc.com/knowledgebase/answer.aspx?ID=665.		
12	Backblaze, See What Can 49,056 Hard Drives Tell Us? Hard Drive Reliability Stats for Q3 2015, (Oct. 14, 2015), https://www.backblaze.com/blog/hard-drive-reliability-q3-2015.		
13 14	Backblaze, CSI: Backblaze – Dissecting 3TB Drive Failure (April 15, 2015), https://www.backblaze.com/blog/3tb-hard-drive-failure.		
15	Backblaze, <i>How long do disk drives last?</i> (Nov. 12, 2013), https://www.backblaze.com/blog/how-long-do-disk-drives-last/.		
1617	MjM Data Recovery Ltd., <i>Head Stack Assembly</i> , https://www.mjm.co.uk/hard-disk-disassembly/hard-disk-head-stack.html.		
18			
19	Documents produced during discovery (beginning Bates numbers): See Exhibit A to Appendix 1.		
20			
21			
22			
23			
24			
25			
26			
27			
28			

DECL. OF ANDREW HOSPODOR ISO CLASS CERT. - 69 CONTAINS MATERIAL DESIGNATED AS HIGHLY CONFIDENTIAL Case No.: 3:16-CV-00523 010581-11 997236 V1

Case 3:16-cv-00523-JCS Document 184-12 Filed 07/26/18 Page 74 of 100

APPENDIX 2

DECL. OF ANDREW HOSPODOR ISO CLASS CERT. - 70 CONTAINS MATERIAL DESIGNATED AS HIGHLY CONFIDENTIAL Case No.: 3:16-CV-00523 010581-11 997236 V1

Andrew David Hospodor, Ph.D.

Santa Cruz, CA 95062-5359, USA 408.921.5099 andy.hospodor@ieee.org

3

4

5

1

2

An accomplished executive, engineer-scientist experienced in both startups and Fortune 500 companies having extensive background in distributed systems, applications and storage. Strengths include industrial-academic relationship building, intellectual property development, Inter Parte Review, Source Code Inspection, data forensics, industrial espionage, strategic planning and technical leadership,

6

7

Education:

8

9

10

11

12

13 14

15

16

17

18

19

20

21

22 23

24

25

26

27 28

Ph.D. Computer Engineering, Santa Clara University, Santa Clara, CA, 1994

Emphasis on storage architecture and embedded systems. Minor in business administration.

Dissertation: A Study of Prefetch in Caching SCSI Disk Drive Buffers.

M.S. Computer Science, Santa Clara University, Santa Clara, CA, 1986

Concentrated studies in networking, communications, data storage, memory hierarchies, interfaces, computer architecture, performance measurement, and error correction coding.

B.S. Computer Engineering, Lehigh University, Bethlehem, PA, 1981

Emphasis on core engineering, computer programming, architecture, physics, and mathematics.

Experience:

GridPlan, Santa Clara, CA., 2003 - present

Architect

Introduced the first open source capacity planning tool for Grid Computing that enabled both Enterprise, e-business and Scientific environments to accurately access the value of computational grids, cloud computing, large-scale Linux clusters, blade servers and distributed compute farms. Provided the crucial ability to assess costperformance of interconnection strategies (such as Infini-Band, 10 Gigabit Ethernet, Myrinet), processors (such as XEON, Opteron), storage, switches and middleware. Established partnerships with Grid Global Forum (GGF), hardware vendors, independent software vendors and open source providers to provide best-of-breed planning technology to IT shops.

Center for Research in Storage Systems, University of California, Santa Cruz, CA, 2009 - 2017

Executive Director and Project Scientist

Engaged in research and funding related activities. Worked with faculty to develop funding strategies and manage industrial sponsors. Participated in NSF and UC led events designed to attract research funding into the data storage space. Built relationships with industrial and academic contacts. Advised graduate and undergraduate students and reviewed their results pre-publication. Created a new area of research in Genomic Data Storage and incorporated into CRSS. Under NSF guidance, organized a group of similar centers in Data Analytics and Data Visualization to propose a new Engineering Research Center in Data Science for Health.

• BookRenter, San Jose, CA, 2006 – 2008

CTO

Led the team that created the first nationwide book rental service. Defined the architecture of a new web 2.0 platform for e-business that combines distributed computing with Ruby on Rails (RoR), mySQL, and web services of partners like Amazon, Barnes & Noble and UPS. Formed capitalization strategy, managed fundraising activities and created partnerships to maximize equity leverage. Responsible for all technical aspects of www.bookrenter.com from hiring to operations.

• Corosoft, Inc., Cupertino, CA, 2001 - 2003

CTO, Founder

Developed a novel approach to managing enterprise e-business applications (databases, app servers, webservers, file services, network services). Introduced Corosoft virtualization software that aggregates resources (servers, networks, storage) behind application services. Built team, raised \$3.8M funding, delivered product to market. Established partnerships in enterprise management (BMC, HP), grid computing (Platform, IBM), network content management (F5) and software (Oracle, Microsoft). Extended strategy to include power management (ACPI) middleware, streaming, clustering file systems, volume management and flexible storage architectures.

• Western Digital Corp., San Jose, CA., 1999 - 2001

Vice President, Systems Architecture

Responsible for all aspects of technology in the formation of new business units. Reported to the Chief Technical Officer and VP of Business Development. Identified new technologies for Enterprise Storage Area Networking (SAN) and Audio/Video streaming storage networking systems, most notably switched fabrics. Drove strategic relationships with well-established software companies such as Microsoft and Veritas for existing technology. Identified and structured relationships with partners and performed due diligence on emerging key technology startups that led to

capital investment of \$2-5M. Created detailed business plans including capitalization, development and staffing requirements.

• Quantum Corp., Milpitas, CA, 1993 - 1999

Storage Architect, Director, Network Storage Architecture Group

Manager, Advanced Storage Applications Group

Led team that developed the first low-cost Network Attached Storage (NAS) disk and tape products. Coordinated company-wide technology direction for storage management, file systems, device drivers, BIOs, and APIs for FibreChannel (FC), Gigabit Ethernet (GbE), InfiniBand (IB), Redundant Arrays of Independent Disks, etc. Responsible for technical relationships with strategic partners, such as Microsoft, Legato, Veritas, Oracle. Supported business units with cross connects to Compatibility Lab, Design Engineering, Sales and Marketing. Participated in customer investigations of new storage applications and developed requirements for new storage markets. Managed architecture and performance labs to provide real data for product planning. Created and managed storage simulator team that laid groundwork for delivery of SCSI, IDE, ATA-33, to 133 interfaces, ultimately resulting in net savings of \$50M+. Participated in architecting, planning and specification of Self-Monitoring, Automatic Reporting Technology (S.M.A.R.T.) for intelligent storage devices.

• Institute for Information Storage Technology, Santa Clara University, 1990 - 1993

IIST Research Fellow and Instructor in Electrical and Computer Engineering (Adjunct Faculty)

Investigated performance of magnetic disk, optical disk, magnetic tape, and buffering in relation to computer system performance. Researched data storage interfaces and architectures and interacted with local data storage industry. Developed relationships with companies such as Quantum, Conner, Seagate, IBM, Iomega and Maxtor. Generated research proposals including budget and staffing requirements and followed proposals through federal government approval. Represented IIST as part of the \$24.5M NSIC Ultra-High Density Storage project. Responsible for teaching graduate and undergraduate courses.

• I/O XEL Incorporated, Santa Clara, CA, 1986 - 1990

Director of Engineering

Developed and delivered performance analysis tools for the data storage industry including The SCSI Benchmark® tester. Clients included Quantum, Priam, Maxtor, Iomega.

• Scientific Micro Systems, Mountain View, CA, 1982 - 1986

- 1			
1	Design Engineer		
2	Designed disk controller firmware for IEEE 796, LSI-11, and SCSI-based disk		
3	controllers with embedded microprocessors and microcontrollers. Participated in successful IPO.		
4	 National Semiconductor, Santa Clara, CA, 1981 - 1982 		
5	System Engineer		
6 7	Designed and delivered the hardware and firmware of a Winchester Disk Controller for IEEE 796 bus.		
8	 Digital Equipment Corporation, Tewksbury, MA, 1978 - 1979 		
9	Software Engineer		
10	Designed conformance tests for compilers and test packages for the VAX 11/780 VMS debugger.		
11	Languages: Java, XML, HTML, UML, c, c++, 8086 assembler, 2900 bit slice, FORTRAN		
12 13	Operating Systems: Windows, NT, XP, ME, Linux, Ultrix, AIX, MS-DOS, VMS, CPM		
14	Interfaces: SCSI, IDE, ATA, FibreChannel, Gigabit Ethernet and TCP/IP, 10 GbE, InfiniBand, ISA, PCI		
15	Patents:		
16	U.S. Patent 9,358,259, "Recycling cannabinoid extractor"		
17 18	U.S. Patent 9,155,767, "Essential element management" Issued October 13, 2015		
19	U.S. Patent 8,980,941, "Controlled Cannabis decarboxylation" Issued March 17, 2015		
20	U.S. Patent 8,343,553, "Essential element extractor." Issued January 01, 2013.		
21	U.S. Patent 7,274,659, "Providing streaming media data." Issued September 25, 2007.		
22	U.S. Patent 7,002,926, "Isochronous Switched Fabric Network." Issued February 21,		
23	2006.		
24	U.S. Patent 6,965,563, "Resource reservation system in a computer network to support end-to-end quality-of-service constraints." Issued November 15, 2005.		
25	U.S. Patent 6,888,831, "Distributed resource reservation system for establishing a		
26	path through a multi-dimensional computer network to support isochronous data." Issued May 3, 2005.		
27			
28	DECL. OF ANDREW HOSPODOR ISO CLASS CERT 74		

DECL. OF ANDREW HOSPODOR ISO CLASS CERT. - 74 CONTAINS MATERIAL DESIGNATED AS HIGHLY CONFIDENTIAL Case No.: 3:16-CV-00523 010581-11 997236 V1

1	U.S. Patent 6,744,772, "Converting asynchronous packets into isochronous packets for transmission through a multi-dimensional switched fabric network." Issued June 1, 2004.
2	
3	U.S. Patent 6,697,914, "Switched node comprising a disk controller with integrated multi-port switching circuitry." Issued February 24, 2004.
5	U.S. Patent 6,615,312, "Method for processing file system service to reproduce stream data." Issued September 2, 2003.
6 7	U.S. Patent 6,603,625, "Spindle synchronizing in a multi-dimensional network." Issued August 5, 2003.
8	U.S. Patent 6,470,420, "Method for designating one of a plurality of addressable storage." Issued October 22, 2002.
9	U.S. Patent 6,012,839, "Method and apparatus to protect data within a disk drive buffer," Issued January 11, 2000.
11 12	U.S. Patent 5,771,397, "SCSI Disconnect/Reconnect timing algorithm for optimal performance." Issued June 23, 1998.
13	U.S. Patent 4,851,998, "Method to Analyze Performance of Computer Peripherals." Issued July 25, 1989.
14 15	As of Jan 2017, the above patents were cited 326 times as prior art in patents granted by the US Patent and Trademark Office.
16	Peer Reviewed Publications:
17	Preeti Gupta, Avani Wildani, Daniel Rosenthal, Ethan L. Miller, Ian Adams, Christina Strong, Andy Hospodor, "An Economic Perspective of Disk vs. Flash Media in
18 19	Archival Storage," Proceedings of the 22th IEEE International Symposium on Modeling, Analysis, and Simulation of Computer and Telecommunication Systems
20	(MASCOTS 2014), September 2014. [Archival Storage]
21	Rekha Pitchumani, Andy Hospodor, Ahmed Amer, Yangwook Kang, Ethan L. Miller, Darrell D. E. Long, "Emulating a Shingled Write Disk," Proceedings of the 20th
22	IEEE International Symposium on Modeling, Analysis, and Simulation of Computer and Telecommunication Systems (MASCOTS 2012), August 2012. [Shingled Disk]
23 24	Ziqian Wan, Alex Nelson, Tao Li, Darrell D. E. Long, Andy Hospodor, "Computer Hard Drive Geolocation by HTTP Feature Extraction," Technical Report UCSC-
25	SSRC-12-04, May 2012. Technical Report UCSC-SSRC-12-04 [Digital Forensics]
26	Philippe Huibonhoa, Chris Williams, JoAnne Holliday, Andy Hospodor, Thomas Schwarz, "Redundancy Management for P2P Storage," CCGrid 2007 CCGrid 2007,
27	the 7th IEEE International Symposium on Cluster Computing and the Grid, Rio De Jeniero, Brazil, May 2007.
28	DECL OF ANDREW HOSPODOR ISO OLASS CERT 75

DECL. OF ANDREW HOSPODOR ISO CLASS CERT. - 75 CONTAINS MATERIAL DESIGNATED AS HIGHLY CONFIDENTIAL Case No.: 3:16-CV-00523 010581-11 997236 V1

1	Thomas J. E. Schwarz, Qin Xin, Ethan L. Miller, Darrell D. E. Long, Andy Hospodor, "Spencer Ng, Disk Scrubbing in Large Archival Storage Systems," Proceedings of the IEEE / ACM International Symposium on Modeling, Analysis, and Simulation of Computer and Telecommunication Systems (MASCOTS), Volendam, The Netherlands, October 2004.		
2			
3			
4	Awarded Best Paper.		
5	A.D. Hospodor, E.L. Miller, "Interconnection Architectures for Petabyte-Scale High-		
6	Performance Storage Systems", Proceedings of the NASA/IEEE Conference on Ma Storage Systems and Technologies (MSST2004), College Park, Maryland, USA,		
7	April, 2004.		
8	Conference rated among top 15% by Citeseer.		
9 10	Andy Hospodor, "Design Alternatives to Improve Access Time Performance Under DOS and UNIX", ASME Journal of Information Storage Systems, vol. 6, 1995.		
11	Andy Hospodor, "Mechanical Access Time, Measurement and Calculation", ASME Journal of Information Storage Systems, vol. 6, 1995.		
12	Andrew David Hospodor, "The Effect of Prefetch in SCSI Disk Drive Cache		
13	Buffers", Doctoral Dissertation, Institute for Information Storage Technology and Computer Engineering Department, Santa Clara University, 1994.		
14	Andrew D. Hospodor, Albert S. Hoagland, "The Changing Nature of Storage		
15 16	Controllers," <i>Proceedings of the IEEE</i> , Special Issue on Data Storage, vol. 81. no. 4, April 1993.		
17	A.S. Hoagland, A.D. Hospodor, "The Information Storage Technology Program at SCU," <i>IEEE Transactions on Education</i> , vol. 36, no. 1, February 1993		
18	Conference Proceedings, Seminars and Presentations:		
19	"The Data Storage Industry: Trends and Performance" invited seminar, Electrical and		
20	Computer Engineering Graduate Seminar, Santa Clara University, January 22, 1998		
21	Andy Hospodor, "Video On the Desktop: High Demands on Disk Drive Performance and Capacity", Computer Technology Review, vol. 16, no. 5, May 1996.		
22	Andy D. Hospodor, "Storage as the Backbone of Video Server Performance,"		
23	Proceedings of the Annual Broadcast Engineering Conference, National Association		
24	of Broadcasters, Las Vegas, NV. April 1996.		
25	"Performance alternatives under DOS and UNIX" and "Mechanical Access Time, Measurement and Calculation", <i>ASME Info. Storage Conf.</i> , New Orleans, LA,		
26	November 1994.		
27			
28	DECL. OF ANDREW HOSPODOR ISO CLASS CERT 76 CONTAINS MATERIAL DESIGNATED AS HIGHLY CONFIDENTIAL		

DECL. OF ANDREW HOSPODOR ISO CLASS CERT. - 76 CONTAINS MATERIAL DESIGNATED AS HIGHLY CONFIDENTIAL Case No.: 3:16-CV-00523 010581-11 997236 V1

1	Andy Hospodor, "Storage Interfaces & Architectures" and "RAID Technology," seminars for Quantum Corp., Milpitas, CA, October 1994.
2	A. Hospodor, "Magnetic Disk Performance from Optical Disk," <i>Proceedings of the IEEE Laser Electro-Optics conference</i> , Maui, HI, May, 1993
4	A. Hospodor, "Hit Ratio of Caching Disk Buffers," Proceedings of the IEEE
5	CompCon conference, San Francisco CA, Februrary, 1992 Andy Hospodor, "Measuring and Modeling Storage Access Times", seminar for UC
6	Berkeley Computer Science Department, January 1992.
7 8	A. Hospodor, "Storage Interfaces and Architectures", an invited tutorial, presented IEEE Systems Design and Networks Conference, Santa Clara, CA, June, 1990.
9	Andy Hospodor, "SCSI Throughput, How it Affects Performance", DiskTest Conference, San Jose CA, July, 1989.
10 11	Andy Hospodor, "Survival SCSI", an invited tutorial, IEEE Systems Design and Networks Conference, Santa Clara, CA, May 1989.
12 13	Andy Hospodor, "Performance Analysis of Computer Peripherals", proceedings of the IEEE Systems Design and Networks Conference, Santa Clara, CA, May 1989.
14	Andy Hospodor, "DCS - the Diagnostic Command Set for SCSI and SCSI-2," <i>ANSI X3B7.1</i> , May 1989.
15 16 17	A. Hospodor, J. Hospodor, "U.S. Science and Technology Museums – 1", <i>IEEE Spectrum</i> , special issue on science and technology for youth, vol. 32, no. 9, September 1995.
18	Andy Hospodor, "Input, Output, and Throughput", <i>Proceedings of the IEEE Systems Design and Networks Conference</i> , Santa Clara, CA, May 1989.
19 20	"The SCSI Disk Drive Performance Evaluation Report", Dataquest report, November, 1988.
21	Andy Hospodor, "A New Look at Analyzing Peripheral Performance," <i>Computer Design</i> , PennWell Publishing, vol. 27, no. 6, March 15, 1988.
2223	Andy Hospodor, "The Quest for the Best," <i>Mini-Micro Systems</i> , Cahners Publishing, vol. 22, no. 11, November, 1988.
2425	Andy Hospodor, "Software Puts SCSI to the Test," <i>Mini-Micro Systems</i> , Cahners Publishing, vol. 20, no. 2, February, 1987.
26	Professional Activities:
27	Member, American Association of Cancer Researchers

DECL. OF ANDREW HOSPODOR ISO CLASS CERT. - 77 CONTAINS MATERIAL DESIGNATED AS HIGHLY CONFIDENTIAL Case No.: 3:16-CV-00523 010581-11 997236 V1

28

1	Member, Society of Cannabis Clinicians
2	 Panelist, National Science Foundation review of Big Data Initiatives 2014, 2015, 2016
3	2010
4	 Panelist, National Science Foundation review of the National Middleware Initiative (NMI) 2004
5	Senior Member, IEEE and Computer Society
6	Member, IEEE P1285 standards committee
7	Member, Infiniband trade association
8	Member ACM, Special Interest Group for Performance Evaluation (SIGMETRICS)
10	Member, Grid Global Forum (GGF), Globus
11	Invitee, the 2004 International School of Grid Computing, Vico Equense, Italy
12	Past program chair of Magnetics Society, Santa Clara Valley chapter
13	 Research affiliate of University of California, Santa Cruz, System Storage Research Center
14 15	Research associate and Lecturer of Santa Clara University, Computer Engineering Dept.
16	Expert Witness:
17	• SBC v. InRange, 2004 – 2005
18	Brooks, Kushman, Detroit, MI, Northern District of Texas, 3:03-cv-00418
19 20	• Exabyte v. Certance, 2005
21	Weil, Gotshall and Manges, Redwood Shores, CA, District of Colorado, 1:04-cv-02061
22	02001
23	E 1 C4 T' 2005 2000
24	• EchoStar v. Tivo, 2005 - 2008
25	Irell and Manella, Irvine, CA, Eastern District of Texas, 5:05-cv-00081
26	• HP v. SBC, 2005
27	Brooks, Kushman, Detroit, MI, District of Delaware, 1:05-cv-00595
28	DEGL OF ANDREW HOGBORON IGO GLAGG CERT. 70

DECL. OF ANDREW HOSPODOR ISO CLASS CERT. - 78 CONTAINS MATERIAL DESIGNATED AS HIGHLY CONFIDENTIAL Case No.: 3:16-CV-00523 010581-11 997236 V1

1	Axalto v. Toshiba, 2006
2	Osha – Liang, Santa Clara, CA, Eastern District of Texas, 5:06-cv-00059
3	• Tandberg Data v. Hewlett-Packard, 2006-2008
4	Bartlitt-Beck, Denver, CO, 01/20/2006, District of Colorado, 1:06-cv-00102
5	Mathworks v. Comsol, 2007-2008
6	Nixon Peabody, Boston, MA, Eastern District of Texas, 6:06-cv-00334
7	Overland Storage v. IBM, 2011
8	Kirkland & Ellis, Washington, DC, Investigation No. 337-TA-746, International Trade Commission
10	Round Rock v. Dell, 2012
11	Farella Braun + Martel LLP, San Francisco, CA, Case: Case 4:11-cv-00332-RC-ALM
12	Overland Storage v. Quantum, 2013
13	Durie Tangri, San Francisco, CA, Case: 3:12-cv-01599-JLS-BLM
14	• Farstone v. Apple, 2014
15	Morrison & Foerster, Los Angeles, CA, Case 1:14-cv-01244-LMB-IDD
16	• AMD v. LG, 2015
17	Fish & Richardson, Washington, DC, Case 8:13-cv-01537-ODW-JEM
18	• CrossRoads v. Quantum, 2015
19	Durie Tangri, San Francisco, CA; Haynes and Boone, Dallas TX, Case No. 14-CV-
20 21	00150-SS
22	MicroStrategy v. OpenRisk, 2015
23	Gleason & Gleason, Boston, MA, Case 1:14-cv-01244-LMB-IDD
24	• EMC v. Pure Storage, 2016
25	Choate Hall, Boston, MA, Case 1:13-cv-12789-JGD
26	Allen v. County of Lake, 2017
27	Porter Scott, Sacramento, CA, Case 3:14-cv-03934-THE
28	

DECL. OF ANDREW HOSPODOR ISO CLASS CERT. - 79 CONTAINS MATERIAL DESIGNATED AS HIGHLY CONFIDENTIAL Case No.: 3:16-CV-00523 010581-11 997236 V1

• Sony v. Fujifilm, 2017

Baker Botts, New York, NY, Investigation No. 337-TA-1036, International Trade Commission

DECL. OF ANDREW HOSPODOR ISO CLASS CERT. - 80 CONTAINS MATERIAL DESIGNATED AS HIGHLY CONFIDENTIAL Case No.: 3:16-CV-00523 010581-11 997236 V1

EXHIBIT A TO APPENDIX 1

Begin Bates	End Bates
BB_CTRL0000171	BB_CTRL0000171
BB_CTRL0001322	BB_CTRL0001322
BB_CTRL0001887	BB_CTRL0001887
BB_CTRL0001888	BB_CTRL0001888
BB_CTRL0001894	BB_CTRL0001894
BB_CTRL0002066	BB_CTRL0002066
BB_CTRL0002176	BB_CTRL0002176
BB_CTRL0002185	BB_CTRL0002185
BB_CTRL0003738	BB_CTRL0003738
BB_CTRL0005172	BB_CTRL0005172
BB_CTRL0005181	BB_CTRL0005181
FED_SEAG0000065	FED_SEAG0000089
FED_SEAG0000134	FED_SEAG0000144
FED_SEAG0000145	FED_SEAG0000155
FED_SEAG0000286	FED_SEAG0000296
FED_SEAG0000367	FED_SEAG0000367
FED_SEAG0000476	FED_SEAG000477
FED_SEAG0000496	FED_SEAG0000497
FED_SEAG0001028	FED_SEAG0001028
FED_SEAG0001029	FED_SEAG0001038
FED_SEAG0001039	FED_SEAG0001048
FED_SEAG0001209	FED_SEAG0001215
FED_SEAG0001216	FED_SEAG0001216
FED_SEAG0001217	FED_SEAG0001233
FED_SEAG0001799	FED_SEAG0001799
FED_SEAG0001800	FED_SEAG0001805
FED_SEAG0001808	FED_SEAG0001808
FED_SEAG0001811	FED_SEAG0001811
FED_SEAG0001814	FED_SEAG0001814
FED_SEAG0001817	FED_SEAG0001817
FED_SEAG0001818	FED_SEAG0001848
FED_SEAG0001849	FED_SEAG0001850
FED_SEAG0001851	FED_SEAG0001881
FED_SEAG0001884	FED_SEAG0001884
FED_SEAG0001918	FED_SEAG0001918
FED_SEAG0001919	FED_SEAG0001949
FED_SEAG0001950	FED_SEAG0001950
FED_SEAG0001951	FED_SEAG0001981
FED_SEAG0001984	FED_SEAG0001984
FED_SEAG0001985	FED_SEAG0001985
FED_SEAG0001986	FED_SEAG0002015
FED_SEAG0002016	FED_SEAG0002016
FED_SEAG0002017	FED_SEAG0002047

FED_SEAG0002052	FED_SEAG0002052
FED_SEAG0002109	FED_SEAG0002110
FED_SEAG0002111	FED_SEAG0002112
FED_SEAG0002206	FED_SEAG0002219
FED_SEAG0002273	FED_SEAG0002273
FED_SEAG0002274	FED_SEAG0002275
FED_SEAG0002276	FED_SEAG0002276
FED_SEAG0002280	FED_SEAG0002282
FED_SEAG0002283	FED_SEAG0002287
FED_SEAG0002305	FED_SEAG0002305
FED_SEAG0002306	FED_SEAG0002317
FED_SEAG0002318	FED_SEAG0002319
FED_SEAG0002320	FED_SEAG0002331
FED_SEAG0002332	FED_SEAG0002335
FED_SEAG0002336	FED_SEAG0002336
FED SEAG0002337	FED_SEAG0002348
_ FED_SEAG0002349	FED_SEAG0002351
FED_SEAG0002352	FED_SEAG0002355
FED_SEAG0002356	FED_SEAG0002357
FED_SEAG0002358	FED_SEAG0002380
FED_SEAG0002663	FED_SEAG0002664
FED_SEAG0002673	FED_SEAG0002680
FED_SEAG0003622	FED_SEAG0003637
FED_SEAG0003639	FED_SEAG0003676
FED_SEAG0003791	FED_SEAG0003795
FED_SEAG0003813	FED_SEAG0003819
 FED_SEAG0003831	FED_SEAG0003832
FED_SEAG0003839	FED_SEAG0003876
FED_SEAG0003912	FED SEAG0003915
FED_SEAG0004163	FED_SEAG0004200
FED_SEAG0003916	FED_SEAG0003953
FED_SEAG0004309	FED_SEAG0004347
FED_SEAG0004351	FED_SEAG0004354
FED SEAG0004355	FED_SEAG0004358
FED_SEAG0004438	FED_SEAG0004475
FED_SEAG0005007	FED SEAG0005008
FED_SEAG0005081	FED_SEAG0005100
FED SEAG0005171	FED_SEAG0005179
FED SEAG0005335	FED SEAG0005335
FED_SEAG0005336	FED_SEAG0005362
FED_SEAG0005363	FED_SEAG0005443
FED_SEAG0005949	FED_SEAG0005949
FED_SEAG0005950	FED_SEAG0005971
FED_SEAG0005930	FED_SEAG0005971
FED_SEAG0005973	FED_SEAG0005994
FED_SEAG0006016	FED_SEAG0006018
FED_SEAG0006019	FED_SEAG0006023
1 FD_2FV0000013	1 LD_3LAG0000023

FED_SEAG0006027	FED_SEAG0006038
FED_SEAG0006048	FED_SEAG0006049
FED_SEAG0006050	FED_SEAG0006059
FED_SEAG0006060	FED_SEAG0006060
FED_SEAG0006071	FED_SEAG0006074
FED_SEAG0006075	FED_SEAG0006078
FED_SEAG0006082	FED_SEAG0006083
FED_SEAG0006084	FED_SEAG0006087
FED SEAG0006088	FED SEAG0006098
 FED_SEAG0006099	FED_SEAG0006101
FED_SEAG0006184	FED_SEAG0006193
FED_SEAG0006214	FED_SEAG0006242
FED_SEAG0006271	FED_SEAG0006349
FED_SEAG0006350	FED_SEAG0006350
FED_SEAG0006351	FED_SEAG0006396
FED_SEAG0006420	FED_SEAG0006422
FED_SEAG0006442	FED_SEAG0006445
FED_SEAG0006446	FED_SEAG0006446
FED_SEAG0006447	FED_SEAG0006455
FED_SEAG0006520	FED_SEAG0006520
FED_SEAG0006521	FED_SEAG0006528
FED_SEAG0006529	FED SEAG0006529
FED_SEAG0006530	FED_SEAG0006531
FED_SEAG0006599	FED_SEAG0006627
FED_SEAG0006755	FED_SEAG0006755
FED_SEAG0000733	FED_SEAG00007305
FED_SEAG0007233	FED_SEAG0007351
FED_SEAG0007590	FED_SEAG0007599
FED_SEAG0007941	FED_SEAG0007942
FED_SEAG0007943	FED_SEAG0007947
FED_SEAG0007948	FED_SEAG0007948
FED_SEAG0008116	FED SEAG0008117
FED_SEAG0008438	FED SEAG0008443
FED_SEAG0008444	FED_SEAG0008454
FED_SEAG0008455	FED_SEAG0008464
FED_SEAG0008465	FED_SEAG0008473
FED_SEAG0008474	FED_SEAG0008477
FED_SEAG0008478	FED_SEAG0008486
FED_SEAG0008478	FED SEAG0008494
FED_SEAG0008487	FED_SEAG0008494
FED_SEAG0008493	FED_SEAG0008501
FED_SEAG0008805	FED_SEAG0008806
	
FED_SEAG0008807 FED_SEAG0008911	FED_SEAG0008807 FED_SEAG0008918
FED_SEAG0008911 FED_SEAG0008920	FED_SEAG0008918
FED_SEAG0008927	FED_SEAG0008923
_	_
FED_SEAG0008933	FED_SEAG0008933

FED_SEAG0008936	FED_SEAG0008941
FED_SEAG0008942	FED_SEAG0008942
FED_SEAG0008943	FED_SEAG0008949
FED_SEAG0008950	FED_SEAG0008950
FED_SEAG0008951	FED_SEAG0008956
FED_SEAG0008957	FED_SEAG0008962
FED SEAG0008963	FED_SEAG0008969
FED_SEAG0008970	FED_SEAG0008974
FED_SEAG0008975	FED_SEAG0008979
FED SEAG0008980	FED_SEAG0008980
FED_SEAG0008981	FED_SEAG0008981
FED_SEAG0008982	FED_SEAG0008982
FED_SEAG0008983	FED_SEAG0008987
FED_SEAG0008988	FED_SEAG0008988
FED_SEAG0008989	FED_SEAG0008999
FED SEAG0009020	FED_SEAG0009022
FED SEAG0009035	FED_SEAG0009059
FED_SEAG0009061	FED_SEAG0009061
FED_SEAG0009062	FED_SEAG0009084
FED_SEAG0009086	FED_SEAG0009086
FED_SEAG0009091	FED_SEAG0009094
FED_SEAG0009095	FED SEAG0009104
FED_SEAG0009095	FED_SEAG0009105
FED_SEAG0009303	FED_SEAG0009304
FED_SEAG0009395	FED_SEAG0009397
FED_SEAG0009398	FED_SEAG0009398
FED_SEAG0009399	FED_SEAG0009399
FED_SEAG0009437	FED_SEAG0009445
FED_SEAG0009470	FED_SEAG0009471
FED_SEAG0009508	FED_SEAG0009513
FED_SEAG0009514	FED_SEAG0009519
FED_SEAG0009520	FED_SEAG0009525
FED_SEAG0009526	FED_SEAG0009538
FED_SEAG0009551	FED_SEAG0009553
FED_SEAG0009554	FED_SEAG0009558
FED_SEAG0009559	FED SEAG0009569
FED_SEAG0009570	FED_SEAG0009575
FED_SEAG0009576	FED_SEAG0009585
FED_SEAG0009576	FED_SEAG0009590
FED_SEAG0009591	FED_SEAG0009590
FED_SEAG0009391	FED_SEAG0009603
FED_SEAG0009609	FED_SEAG0009609
	
FED_SEAG0009612 FED_SEAG0009624	FED_SEAG0009612 FED_SEAG0009624
FED_SEAG0009625	FED_SEAG0009631
FED_SEAG0009623	FED_SEAG0009637
_	_
FED_SEAG0009638	FED_SEAG0009643

FED_SEAG0009644	FED_SEAG0009650
FED_SEAG0009651	FED_SEAG0009657
FED_SEAG0009658	FED_SEAG0009663
FED_SEAG0009664	FED_SEAG0009669
FED_SEAG0009670	FED_SEAG0009702
FED_SEAG0009703	FED_SEAG0009708
FED_SEAG0009709	FED_SEAG0009737
FED SEAG0009738	FED_SEAG0009743
FED_SEAG0009744	FED_SEAG0009748
_ FED_SEAG0009824	FED_SEAG0009836
_ FED_SEAG0009837	FED_SEAG0009848
FED_SEAG0009849	FED_SEAG0009859
FED_SEAG0009860	FED_SEAG0009870
FED_SEAG0009871	FED_SEAG0009873
FED_SEAG0009874	FED_SEAG0009876
FED SEAG0009877	FED_SEAG0009878
FED_SEAG0009879	FED_SEAG0009880
FED_SEAG0009883	FED_SEAG0009892
FED_SEAG0009894	FED_SEAG0009896
FED_SEAG0009944	FED_SEAG0009957
FED_SEAG0009959	FED_SEAG0009960
FED_SEAG0010009	FED SEAG0010054
FED_SEAG0010063	FED_SEAG0010034
FED_SEAG0010073	FED_SEAG0010072
FED_SEAG0010075	FED_SEAG0010091
FED_SEAG0010031	FED_SEAG0010031
FED_SEAG0010112	FED_SEAG0010132
FED_SEAG0010120	FED_SEAG0010174
FED_SEAG0010155	FED_SEAG0010337
FED_SEAG0010237	FED_SEAG0010338
FED_SEAG0010339	FED_SEAG0010420
FED_SEAG0010333	FED_SEAG0010421
FED_SEAG0010421	FED_SEAG0010514
FED_SEAG0010422	FED_SEAG0010515
FED_SEAG0010516	FED SEAG0010610
FED_SEAG0010510	FED_SEAG0010611
FED_SEAG0010011	FED_SEAG0010011
FED_SEAG0010012	FED_SEAG0010701
FED_SEAG0010701	FED_SEAG0010701
FED_SEAG0010702	FED_SEAG0010790
FED_SEAG0010791	FED_SEAG0010731
FED_SEAG0010732	FED_SEAG0010812
FED_SEAG0010813	_
FED_SEAG0010814 FED_SEAG0010866	FED_SEAG0010865 FED_SEAG0010866
FED_SEAG0010867	FED_SEAG0010800
FED_SEAG0010807	FED_SEAG0010919
_	_
FED_SEAG0010921	FED_SEAG0010928

FED_SEAG0010929	FED_SEAG0010929
FED_SEAG0010930	FED_SEAG0010936
FED_SEAG0010937	FED_SEAG0010937
FED_SEAG0010938	FED_SEAG0011012
FED_SEAG0011013	FED_SEAG0011013
FED_SEAG0011014	FED_SEAG0011083
FED_SEAG0011014	FED_SEAG0011084
_	_
FED_SEAG0011085	FED_SEAG0011151
FED_SEAG0011152	FED_SEAG0011152
FED_SEAG0011153	FED_SEAG0011220
FED_SEAG0011221	FED_SEAG0011221
FED_SEAG0011222	FED_SEAG0011276
FED_SEAG0011277	FED_SEAG0011277
FED_SEAG0011278	FED_SEAG0011341
FED_SEAG0011970	FED_SEAG0011979
FED_SEAG0011980	FED_SEAG0011988
FED_SEAG0011989	FED_SEAG0011989
FED_SEAG0011909	FED_SEAG0011991
FED_SEAG0011990	FED_SEAG0011991
_	_
FED_SEAG0011993	FED_SEAG0011993
FED_SEAG0011994	FED_SEAG0011994
FED_SEAG0011995	FED_SEAG0011995
FED_SEAG0011996	FED_SEAG0011998
FED_SEAG0011999	FED_SEAG0012029
FED_SEAG0012031	FED_SEAG0012033
FED_SEAG0012037	FED_SEAG0012037
FED_SEAG0012193	FED_SEAG0012271
FED_SEAG0012274	FED_SEAG0012323
FED_SEAG0012374	FED_SEAG0012378
FED_SEAG0012387	FED SEAG0012389
FED_SEAG0012443	FED_SEAG0012468
FED_SEAG0012445	FED_SEAG0012472
_	_
FED_SEAG0012473	FED_SEAG0012480
FED_SEAG0012481	FED_SEAG0012481
FED_SEAG0012482	FED_SEAG0012484
FED_SEAG0012490	FED_SEAG0012520
FED_SEAG0012522	FED_SEAG0012553
FED_SEAG0012555	FED_SEAG0012582
FED_SEAG0012589	FED_SEAG0012614
FED_SEAG0012621	FED_SEAG0012640
FED_SEAG0012642	FED_SEAG0012661
FED_SEAG0012663	FED_SEAG0012687
FED_SEAG0012701	FED_SEAG0012726
FED_SEAG0012800	FED_SEAG0012826
FED_SEAG0012000	FED_SEAG0012020
_	_
FED_SEAG0013098	FED_SEAG0013122
FED_SEAG0013240	FED_SEAG0013258

FED_SEAG0013314	FED_SEAG0013316
FED_SEAG0013317	FED_SEAG0013323
FED_SEAG0013574	FED_SEAG0013608
FED_SEAG0013670	FED_SEAG0013676
FED_SEAG0013687	FED_SEAG0013693
FED_SEAG0013825	FED_SEAG0013892
FED_SEAG0013895	FED_SEAG0013897
FED_SEAG0013898	FED_SEAG0013904
FED_SEAG0013905	FED_SEAG0013912
FED_SEAG0014121	FED_SEAG0014121
FED_SEAG0014164	FED_SEAG0014170
FED_SEAG0014203	FED_SEAG0014206
FED_SEAG0014208	FED_SEAG0014212
FED SEAG0014355	FED SEAG0014386
FED_SEAG0014389	FED_SEAG0014409
FED_SEAG0014790	FED_SEAG0014790
FED_SEAG0015033	FED SEAG0015053
FED_SEAG0015054	FED_SEAG0015078
FED_SEAG0015140	FED_SEAG0015140
FED_SEAG0015399	FED_SEAG0015429
FED_SEAG0015440	FED_SEAG0015451
FED_SEAG0015567	FED_SEAG0015568
FED_SEAG0015659	FED_SEAG0015659
FED_SEAG0015894	FED_SEAG0015894
FED_SEAG0015898	FED_SEAG0015900
FED_SEAG0015940	FED_SEAG0016021
FED SEAG0016025	FED SEAG0016039
FED_SEAG0016040	FED_SEAG0016053
FED_SEAG0016460	FED_SEAG0016460
FED_SEAG0016565	FED SEAG0016565
FED_SEAG0016639	FED_SEAG0016639
FED SEAG0016777	FED SEAG0016780
FED_SEAG0016781	FED_SEAG0016785
FED_SEAG0016786	FED_SEAG0016803
FED_SEAG0016804	FED SEAG0016810
FED_SEAG0016811	FED_SEAG0016811
FED_SEAG0016812	FED_SEAG0016817
FED_SEAG0016818	FED_SEAG0016818
FED_SEAG0016819	FED_SEAG0016824
FED_SEAG0016825	FED_SEAG0016825
FED_SEAG0016826	FED_SEAG0016830
FED_SEAG0016831	FED_SEAG0016835
FED SEAG0016836	FED_SEAG0016838
FED_SEAG0016862	FED_SEAG0016866
FED_SEAG0016867	FED_SEAG0016871
FED_SEAG0016872	FED_SEAG0016874
FED_SEAG0016875	FED_SEAG0016878

FED_SEAG0016879	FED_SEAG0016882
FED_SEAG0016883	FED_SEAG0016886
FED_SEAG0016888	FED_SEAG0016890
FED_SEAG0016893	FED_SEAG0016895
FED_SEAG0016896	FED_SEAG0016898
FED_SEAG0016908	FED_SEAG0016912
FED_SEAG0016913	FED_SEAG0016917
FED_SEAG0016918	FED_SEAG0016922
FED_SEAG0016923	FED_SEAG0016925
FED_SEAG0016926	FED_SEAG0016928
FED_SEAG0016929	FED_SEAG0016931
FED_SEAG0016932	FED_SEAG0016934
FED_SEAG0016935	FED_SEAG0016937
FED_SEAG0016938	FED_SEAG0016941
FED_SEAG0016942	FED_SEAG0016949
FED_SEAG0016950	FED_SEAG0016956
FED SEAG0016957	FED_SEAG0016962
FED_SEAG0016963	FED_SEAG0016964
FED_SEAG0016965	FED_SEAG0016968
FED_SEAG0016969	FED_SEAG0016984
FED_SEAG0016985	FED_SEAG0016990
FED_SEAG0016991	FED_SEAG0017019
FED_SEAG0017426	FED_SEAG0017438
FED_SEAG0017493	FED_SEAG0017532
FED_SEAG0017785	FED_SEAG0017820
FED_SEAG0017886	FED_SEAG0017896
 FED_SEAG0017897	FED_SEAG0017907
FED_SEAG0017913	FED_SEAG0017914
FED_SEAG0017915	FED_SEAG0017919
FED_SEAG0018048	FED_SEAG0018052
FED_SEAG0018053	FED_SEAG0018057
FED_SEAG0018185	FED_SEAG0018188
FED SEAG0018203	FED_SEAG0018206
FED_SEAG0018735	FED_SEAG0018735
FED SEAG0018786	FED_SEAG0018787
FED SEAG0018789	FED_SEAG0018789
FED_SEAG0018791	FED_SEAG0018791
FED_SEAG0018818	FED_SEAG0018819
FED_SEAG0018820	FED_SEAG0018820
FED_SEAG0018822	FED_SEAG0018822
FED_SEAG0018823	FED_SEAG0018827
FED_SEAG0018828	FED_SEAG0018829
FED_SEAG0018931	FED_SEAG0018932
FED_SEAG0018933	FED_SEAG0018933
FED_SEAG0018965	FED_SEAG0018968
FED_SEAG0018992	FED_SEAG0019004
FED_SEAG0019905	FED_SEAG0019005
(30013003	

FED_SEAG0019006	FED_SEAG0019016
FED_SEAG0019017	FED_SEAG0019017
FED_SEAG0019018	FED_SEAG0019029
FED_SEAG0019030	FED_SEAG0019030
FED_SEAG0019045	FED_SEAG0019094
FED_SEAG0019106	FED_SEAG0019112
FED_SEAG0019113	FED_SEAG0019113
FED_SEAG0019114	FED_SEAG0019114
FED_SEAG0019115	FED_SEAG0019115
FED_SEAG0019116	FED_SEAG0019126
FED_SEAG0019398	FED_SEAG0019436
FED_SEAG0020167	FED_SEAG0020168
FED_SEAG0020169	FED_SEAG0020169
FED SEAG0020170	FED_SEAG0020170
FED_SEAG0020175	FED_SEAG0020176
FED_SEAG0020172	FED_SEAG0020174
FED_SEAG0020806	FED SEAG0020857
FED_SEAG0021146	FED_SEAG0021146
FED_SEAG0021140	FED_SEAG0021140
FED_SEAG0021134	FED SEAG0021194
_	_
FED_SEAG0021569	FED_SEAG0021605
FED_SEAG0021613	FED_SEAG0021623
FED_SEAG0021624	FED_SEAG0021634
FED_SEAG0021635	FED_SEAG0021645
FED_SEAG0021665	FED_SEAG0021665
FED_SEAG0021666	FED_SEAG0021685
FED_SEAG0021686	FED_SEAG0021687
FED_SEAG0021688	FED_SEAG0021707
FED_SEAG0021708	FED_SEAG0021708
FED_SEAG0021709	FED_SEAG0021710
FED_SEAG0021717	FED_SEAG0021720
FED_SEAG0021769	FED_SEAG0021782
FED_SEAG0021810	FED_SEAG0021818
FED_SEAG0021819	FED_SEAG0021820
FED_SEAG0021892	FED_SEAG0021893
FED_SEAG0021894	FED_SEAG0021912
FED_SEAG0021913	FED_SEAG0021916
FED_SEAG0021917	FED_SEAG0021937
FED_SEAG0021938	FED_SEAG0021948
FED_SEAG0021949	FED_SEAG0021959
FED_SEAG0021960	FED_SEAG0021976
FED_SEAG0021977	FED_SEAG0021987
FED_SEAG0021998	FED_SEAG0022010
FED_SEAG0022105	FED_SEAG0022109
FED_SEAG0022308	FED_SEAG0022310
FED_SEAG0022700	FED_SEAG0022702
FED_SEAG0022703	FED_SEAG0022702
1 LD_3LAG0022703	1 LD_3LAG0022703

FED_SEAG0022704	FED_SEAG0022704
FED_SEAG0022705	FED_SEAG0022705
FED_SEAG0022706	FED_SEAG0022706
FED_SEAG0022707	FED_SEAG0022707
FED_SEAG0022708	FED_SEAG0022709
FED_SEAG0022914	FED_SEAG0022920
FED_SEAG0023929	FED_SEAG0023932
FED_SEAG0023938	FED SEAG0023943
 FED_SEAG0024003	FED_SEAG0024008
 FED_SEAG0024009	FED_SEAG0024014
FED_SEAG0024052	FED_SEAG0024056
FED_SEAG0024057	FED_SEAG0024059
FED_SEAG0024060	FED_SEAG0024069
FED_SEAG0024080	FED_SEAG0024080
FED_SEAG0024164	FED_SEAG0024266
FED_SEAG0024104	FED SEAG0024653
FED_SEAG0024654	FED_SEAG0024654
_	_
FED_SEAG0024655	FED_SEAG0024657
FED_SEAG0024670	FED_SEAG0024670
FED_SEAG0024671	FED_SEAG0024675
FED_SEAG0024682	FED_SEAG0024683
FED_SEAG0024695	FED_SEAG0024696
FED_SEAG0024743	FED_SEAG0024763
FED_SEAG0024764	FED_SEAG0024764
FED_SEAG0024765	FED_SEAG0024765
FED_SEAG0024766	FED_SEAG0024768
FED_SEAG0025567	FED_SEAG0025572
FED_SEAG0025580	FED_SEAG0025586
FED_SEAG0025587	FED_SEAG0025587
FED_SEAG0025594	FED_SEAG0025596
FED_SEAG0025597	FED_SEAG0025603
FED_SEAG0025618	FED_SEAG0025625
FED_SEAG0025640	FED_SEAG0025641
FED_SEAG0025642	FED_SEAG0025646
FED_SEAG0025907	FED_SEAG0025908
FED_SEAG0025909	FED_SEAG0025911
FED_SEAG0025913	FED_SEAG0025974
FED_SEAG0026113	FED_SEAG0026120
FED_SEAG0026135	FED_SEAG0026185
FED_SEAG0026552	FED_SEAG0026576
FED_SEAG0026577	FED_SEAG0026696
FED_SEAG0026697	FED_SEAG0026750
FED_SEAG0026751	FED_SEAG0026794
FED_SEAG0026795	FED_SEAG0026838
FED_SEAG0026839	FED_SEAG0026866
FED_SEAG0026867	FED_SEAG0026893
FED_SEAG0026894	FED_SEAG0026895
_	_

FED_SEAG0026896	FED_SEAG0026898
FED_SEAG0026899	FED_SEAG0026963
FED_SEAG0026964	FED_SEAG0027045
FED SEAG0027046	FED SEAG0027174
FED_SEAG0027237	FED_SEAG0027237
_ FED_SEAG0027238	FED_SEAG0027238
FED_SEAG0027239	FED SEAG0027239
FED_SEAG0027240	FED_SEAG0027240
FED_SEAG0027241	FED_SEAG0027241
FED_SEAG0027242	FED_SEAG0027241
FED_SEAG0027243	FED SEAG0027243
FED_SEAG0027285	FED_SEAG0027322
FED_SEAG0027800	FED_SEAG0027802
FED_SEAG0027805	FED_SEAG0027808
_	_
FED_SEAG0028126	FED_SEAG0028126
FED_SEAG0027918	FED_SEAG0027930
FED_SEAG0029913	FED_SEAG0029913
FED_SEAG0030293	FED_SEAG0030331
FED_SEAG0030388	FED_SEAG0030390
FED_SEAG0030391	FED_SEAG0030436
FED_SEAG0030777	FED_SEAG0030817
FED_SEAG0030657	FED_SEAG0030700
FED_SEAG0030856	FED_SEAG0030893
FED_SEAG0030932	FED_SEAG0030969
FED_SEAG0031047	FED_SEAG0031090
FED_SEAG0031453	FED_SEAG0031473
FED_SEAG0031474	FED_SEAG0031513
FED_SEAG0031713	FED_SEAG0031732
FED_SEAG0031733	FED_SEAG0031748
FED_SEAG0031749	FED_SEAG0031766
FED_SEAG0031767	FED_SEAG0031788
FED_SEAG0031789	FED_SEAG0031810
FED_SEAG0031811	FED_SEAG0031835
FED_SEAG0031892	FED_SEAG0031923
FED_SEAG0031924	FED_SEAG0031942
FED_SEAG0031943	FED_SEAG0031961
FED_SEAG0031962	FED_SEAG0031980
FED_SEAG0032020	FED_SEAG0032055
FED_SEAG0032239	FED_SEAG0032252
FED_SEAG0032295	FED_SEAG0032331
FED_SEAG0032372	FED_SEAG0032384
FED_SEAG0034829	FED_SEAG0034841
FED_SEAG0034928	FED_SEAG0034928
FED_SEAG0034930	FED_SEAG0034930
FED_SEAG0034931	FED_SEAG0034931
FED_SEAG0034968	FED_SEAG0035006
FED_SEAG0035527	FED_SEAG0035531

FED_SEAG0045752	FED_SEAG0045759
FED_SEAG0053031	FED_SEAG0053031
FED_SEAG0054681	FED_SEAG0054711
FED_SEAG0054712	FED_SEAG0054719
FED_SEAG0054736	FED_SEAG0054736
FED_SEAG0054737	FED_SEAG0054737
FED_SEAG0054745	FED_SEAG0054748
FED_SEAG0054823	FED_SEAG0054823
FED_SEAG0054825	FED_SEAG0054825
FED_SEAG0054826	FED_SEAG0054826
FED_SEAG0054827	FED_SEAG0054827
FED_SEAG0054829	FED_SEAG0054832
FED_SEAG0054833	FED_SEAG0054837
FED_SEAG0054864	FED_SEAG0054867
FED_SEAG0054893	FED_SEAG0054896
FED_SEAG0054917	FED_SEAG0054921
FED_SEAG0054922	FED_SEAG0054924
FED_SEAG0054925	FED_SEAG0054927
FED_SEAG0054928	FED_SEAG0054929
FED_SEAG0054930	FED_SEAG0054931
FED_SEAG0054932	FED_SEAG0054934
FED_SEAG0054935	FED_SEAG0054937
FED_SEAG0054938	FED_SEAG0054939
FED_SEAG0054959	FED_SEAG0054962
FED_SEAG0054963	FED_SEAG0054965
FED_SEAG0054966	FED_SEAG0054967
FED_SEAG0054968	FED_SEAG0054969
FED_SEAG0054970	FED_SEAG0054971
FED_SEAG0054972	FED_SEAG0054977
FED_SEAG0054978	FED_SEAG0054982
FED_SEAG0054991	FED_SEAG0054993
FED_SEAG0054994	FED_SEAG0054996
FED_SEAG0054997	FED_SEAG0054999
FED_SEAG0055000	FED_SEAG0055006
FED_SEAG0055020	FED_SEAG0055021
FED_SEAG0055022	FED_SEAG0055025
FED_SEAG0055026	FED_SEAG0055040
FED_SEAG0055041	FED_SEAG0055046
FED_SEAG0055065	FED_SEAG0055067
FED_SEAG0055073	FED_SEAG0055078
FED_SEAG0055084	FED_SEAG0055086
FED_SEAG0055087	FED_SEAG0055093
FED_SEAG0055139	FED_SEAG0055143
FED_SEAG0055149	FED_SEAG0055151
FED_SEAG0055152	FED_SEAG0055153
FED_SEAG0055154	FED_SEAG0055156
FED_SEAG0055162	FED_SEAG0055165

FED_SEAG0055166	FED_SEAG0055168
FED_SEAG0055169	FED_SEAG0055170
FED_SEAG0055171	FED_SEAG0055220
FED_SEAG0055247	FED_SEAG0055247
FED_SEAG0055248	FED_SEAG0055248
FED_SEAG0055249	FED_SEAG0055252
FED_SEAG0055253	FED_SEAG0055253
FED_SEAG0055254	FED_SEAG0055261
FED_SEAG0055262	FED_SEAG0055262
FED_SEAG0055263	FED SEAG0055269
FED SEAG0055270	FED_SEAG0055271
FED_SEAG0055272	FED_SEAG0055272
FED_SEAG0055273	FED_SEAG0055292
 FED_SEAG0055341	FED_SEAG0055359
FED_SEAG0055371	FED_SEAG0055388
FED_SEAG0055389	FED_SEAG0055410
FED_SEAG0055411	FED_SEAG0055431
FED_SEAG0055476	FED_SEAG0055495
FED_SEAG0055589	FED_SEAG0055609
FED_SEAG0055612	FED_SEAG0055632
FED_SEAG0055634	FED_SEAG0055654
FED SEAG0055656	FED SEAG0055674
FED_SEAG0055831	FED_SEAG0055849
FED_SEAG0055783	FED_SEAG0055783
FED_SEAG0055784	FED_SEAG0055786
FED_SEAG0055922	FED_SEAG0056034
FED_SEAG0056341	FED_SEAG0056374
FED_SEAG0056259	FED_SEAG0056298
FED_SEAG0056387	FED_SEAG0056398
FED_SEAG0056399	FED_SEAG0056447
FED_SEAG0056540	FED_SEAG0056542
FED_SEAG0056543	FED_SEAG0056543
FED_SEAG0056986	FED_SEAG0057050
FED_SEAG0057123	FED_SEAG0057132
FED_SEAG0057214	FED_SEAG0057216
FED_SEAG0057246	FED SEAG0057259
FED_SEAG0057263	FED_SEAG0057268
FED_SEAG0057269	FED_SEAG0057276
FED_SEAG0057277	FED_SEAG0057403
FED_SEAG0057404	FED_SEAG0057408
FED_SEAG0057409	FED_SEAG0057410
FED_SEAG0057405	FED_SEAG0057410
FED_SEAG0057411	FED_SEAG0057424
FED_SEAG0057425	FED_SEAG0057424
FED_SEAG0057423	FED_SEAG0057437
FED_SEAG0057439	FED_SEAG0057455
FED_SEAG0057456	FED_SEAG0057456
1 LD_3LAG0037430	1 LD_3LAG0037430

FED_SEAG0057457	FED_SEAG0057470
FED_SEAG0057471	FED_SEAG0057494
FED_SEAG0057495	FED_SEAG0057519
FED_SEAG0057521	FED_SEAG0057537
FED_SEAG0057538	FED_SEAG0057543
FED_SEAG0057544	FED_SEAG0057561
FED SEAG0057562	FED SEAG0057562
FED_SEAG0057563	FED SEAG0057566
FED_SEAG0057567	FED SEAG0057567
FED_SEAG0057568	FED_SEAG0057571
FED SEAG0057572	FED_SEAG0057572
FED_SEAG0057573	FED_SEAG0057575
FED_SEAG0057576	FED SEAG0057576
FED_SEAG0057577	FED_SEAG0057579
FED_SEAG0057577	FED_SEAG0057575
FED_SEAG0057583	FED_SEAG0057601
FED_SEAG0057602	FED_SEAG0057637
_	
FED_SEAG0057638	FED_SEAG0057638
FED_SEAG0057639	FED_SEAG0057648
FED_SEAG0057649	FED_SEAG0057649
FED_SEAG0057650	FED_SEAG0057657
FED_SEAG0057658	FED_SEAG0057659
FED_SEAG0057660	FED_SEAG0057675
FED_SEAG0057676	FED_SEAG0057676
FED_SEAG0057677	FED_SEAG0057684
FED_SEAG0057685	FED_SEAG0057685
FED_SEAG0057686	FED_SEAG0057693
FED_SEAG0057694	FED_SEAG0057694
FED_SEAG0057695	FED_SEAG0057702
FED_SEAG0057703	FED_SEAG0057706
FED_SEAG0057707	FED_SEAG0057714
FED_SEAG0057715	FED_SEAG0057721
FED_SEAG0057722	FED_SEAG0057722
FED_SEAG0057723	FED_SEAG0057730
FED_SEAG0057731	FED_SEAG0057731
FED_SEAG0057732	FED_SEAG0057739
FED_SEAG0057740	FED_SEAG0057740
FED_SEAG0057741	FED_SEAG0057748
FED_SEAG0057749	FED_SEAG0057752
FED_SEAG0057753	FED_SEAG0057753
FED_SEAG0057754	FED_SEAG0057754
FED_SEAG0057755	FED_SEAG0057757
FED_SEAG0057758	FED_SEAG0057758
_ FED_SEAG0057759	FED_SEAG0057759
FED_SEAG0057760	FED_SEAG0057760
_ FED_SEAG0057761	FED_SEAG0057770
_ FED_SEAG0057771	FED_SEAG0057771
_	_

FED_SEAG0057772	FED_SEAG0057781
FED_SEAG0057782	FED_SEAG0057783
FED_SEAG0057784	FED_SEAG0057838
FED_SEAG0057839	FED_SEAG0057840
FED_SEAG0057841	FED_SEAG0057896
FED_SEAG0057897	FED_SEAG0057901
FED_SEAG0057902	FED_SEAG0057902
FED_SEAG0057903	FED_SEAG0057904
FED_SEAG0057905	FED_SEAG0057958
FED_SEAG0057959	FED_SEAG0057965
FED_SEAG0057966	FED_SEAG0057966
FED_SEAG0057967	FED_SEAG0057972
FED_SEAG0057973	FED_SEAG0057979
FED_SEAG0057980	FED_SEAG0057981
FED_SEAG0057982	FED_SEAG0058036
FED_SEAG0058037	FED_SEAG0058039
FED_SEAG0058040	FED_SEAG0058088
FED_SEAG0058089	FED_SEAG0058090
FED_SEAG0058091	FED_SEAG0058097
FED_SEAG0058098	FED_SEAG0058109
FED_SEAG0058110	FED_SEAG0058113
FED_SEAG0058114	FED_SEAG0058114
FED_SEAG0058115	FED_SEAG0058116
FED_SEAG0058117	FED_SEAG0058167
FED_SEAG0058168	FED_SEAG0058171
FED_SEAG0058172	FED_SEAG0058173
FED_SEAG0058174	FED_SEAG0058174
FED_SEAG0058175	FED_SEAG0058175
FED_SEAG0058176	FED_SEAG0058183
FED_SEAG0058184	FED_SEAG0058197
FED_SEAG0058198	FED_SEAG0058199
FED_SEAG0058200	FED_SEAG0058233
FED_SEAG0058234	FED_SEAG0058235
FED_SEAG0058236	FED_SEAG0058287
FED_SEAG0058288	FED_SEAG0058288
FED_SEAG0058289	FED_SEAG0058296
FED_SEAG0058297	FED_SEAG0058298
FED_SEAG0058299	FED_SEAG0058304
FED_SEAG0058305	FED_SEAG0058307
FED_SEAG0058308	FED_SEAG0058310
FED_SEAG0058311	FED_SEAG0058313
FED_SEAG0058314	FED_SEAG0058314
FED_SEAG0058315	FED_SEAG0058315
FED_SEAG0058316	FED_SEAG0058319
FED_SEAG0058320	FED_SEAG0058338
FED_SEAG0058339	FED_SEAG0058352
FED_SEAG0058353	FED_SEAG0058369

FED_SEAG0058430	FED_SEAG0058439
FED_SEAG0058456	FED_SEAG0058466
FED_SEAG0058478	FED_SEAG0058491
FED_SEAG0058519	FED_SEAG0058526
FED_SEAG0058527	FED_SEAG0058534
FED_SEAG0058535	FED_SEAG0058541
FED_SEAG0058542	FED_SEAG0058542
FED_SEAG0058543	FED_SEAG0058546
FED_SEAG0058547	FED_SEAG0058551
FED_SEAG0058552	FED_SEAG0058552
FED_SEAG0058553	FED_SEAG0058559
FED_SEAG0058560	FED_SEAG0058560
FED_SEAG0058586	FED_SEAG0058591
FED_SEAG0058592	FED_SEAG0058599
FED_SEAG0058600	FED_SEAG0058608
FED_SEAG0058609	FED_SEAG0058612
FED_SEAG0058613	FED_SEAG0058616
FED_SEAG0058617	FED_SEAG0058630
FED_SEAG0058631	FED_SEAG0058633
FED_SEAG0058634	FED_SEAG0058709
FED_SEAG0058710	FED_SEAG0058711
FED_SEAG0058712	FED_SEAG0058782
FED_SEAG0058783	FED_SEAG0058783
FED_SEAG0058784	FED_SEAG0058809
FED_SEAG0058810	FED_SEAG0058812
FED_SEAG0058813	FED_SEAG0058819
FED_SEAG0058820	FED_SEAG0058846
FED_SEAG0058847	FED_SEAG0058852
FED_SEAG0058853	FED_SEAG0058859
FED_SEAG0058860	FED_SEAG0058866
FED_SEAG0058867	FED_SEAG0058873
FED_SEAG0058874	FED_SEAG0058875
FED_SEAG0058876	FED_SEAG0058880
FED_SEAG0058881	FED_SEAG0058891
FED_SEAG0060976	FED_SEAG0060982
FED_SEAG0068026	FED_SEAG0068059
FED_SEAG0069892	FED_SEAG0069899